

General Information

Date & Time: 28, Jul, 2025 18:20

Make	Nissan	Model	NV350
YOM	2020	Odo Meter Reading	98,109
Registration No.	NGP2861	Chassis No.	JN1TC2E26Z0062324
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



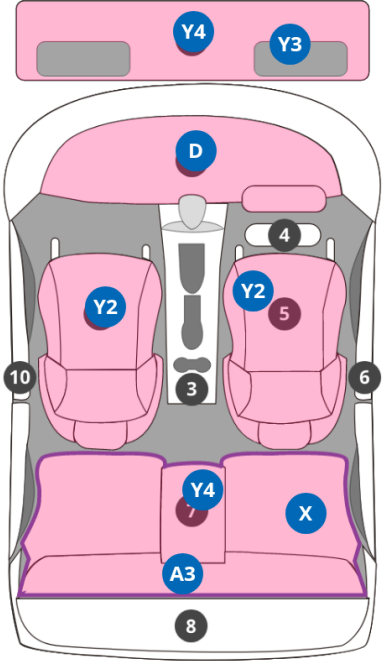
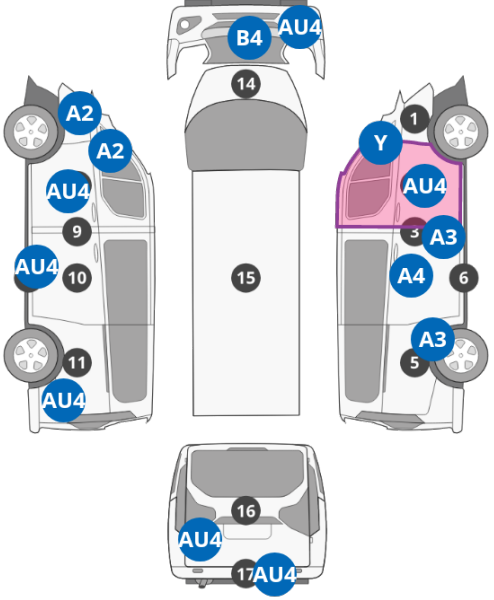
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.6	100	96	109
2	Boot Lid	108.3	86	94	145
3	Roof	104.1	106	100	111/100
4	Left Front Fender	102.6	108	97	103
5	Left Front Door	107.0	108	108	105
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	99.0	107	101	89
9	Right Front Fender	102.0	109	96	101
10	Right Front Door	109.3	104	111	113
11	Center Panel Right				
12	Right Rear Door	106.6	99	132	90
13	Right Back Panel	97.7	96	97	100

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / Rear Seat Head Rest - Worn, Peel, Cut - Medium / Rear Seat - Grime - Large / Rear Seat - Partially Missing - Yes / (L) Front Seat - Grime - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Modified - Large / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Center Panel - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Mirror - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Right side mirror damaged. Crack taillight. Manual Transmission issue. One rear seat missing. Rear seat issue. ABS warning lamp. Seats has molds. Without warranty booklet, jack and tools. With spare tire. 1 key. With LTO plate.</p>