


General Information

Date & Time: 29, Jul, 2025 16:59

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	47,533
Registration No.	CAV8055	Chassis No.	PA1B18F37L4119364
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition

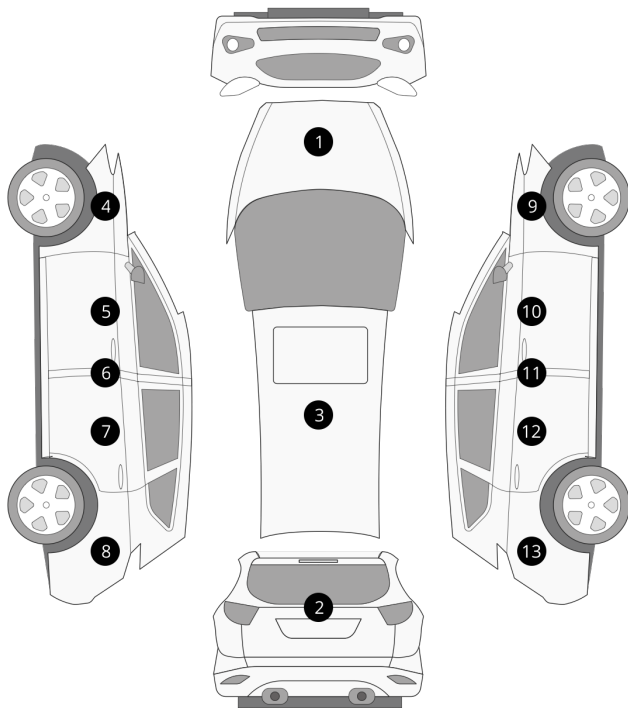

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.3	105	148	123
2	Boot Lid	117.3	116	118	118
3	Roof	107.2	113	102	111/103
4	Left Front Fender	101.3	100	99	105
5	Left Front Door	121.0	103	101	159
6	Center Panel Left				
7	Left Rear Door	103.3	103	105	102
8	Left Back Panel	109.6	116	113	100
9	Right Front Fender	100.0	102	100	98
10	Right Front Door	120.7	99	90	173
11	Center Panel Right				
12	Right Rear Door	130.6	144	144	104
13	Right Back Panel	138.6	139	142	135

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, no jack and tools, no spare tire, damaged foglamps cover