

General Information

Date & Time: 29, Jul, 2025 17:06

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,831
Registration No.	IAF6847	Chassis No.	PA1B18F38R4260016
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



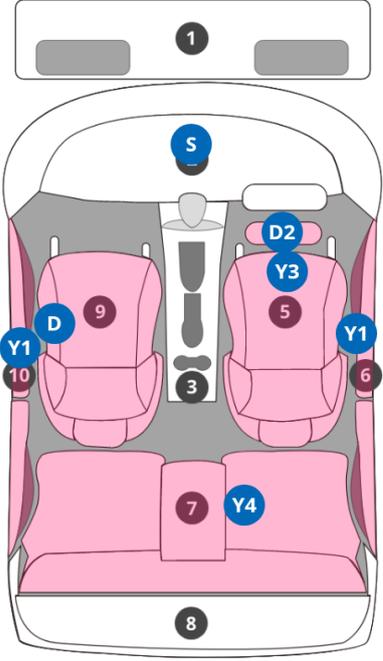
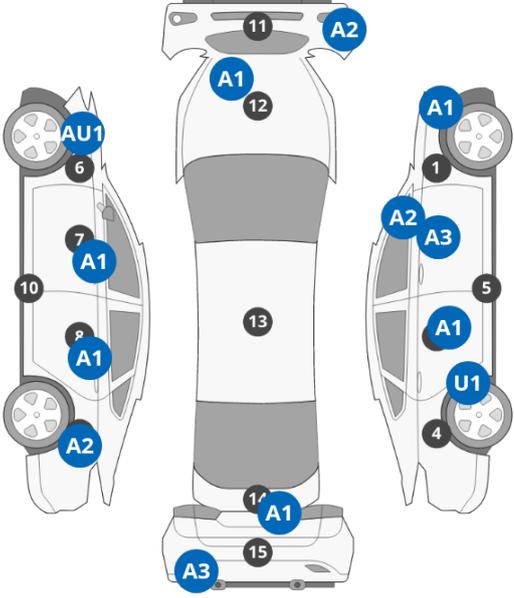
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	116	107	114
2	Boot Lid	102.6	105	96	107
3	Roof	104.4	102	105	98/113
4	Left Front Fender	101.7	107	98	100
5	Left Front Door	107.0	105	109	107
6	Center Panel Left				
7	Left Rear Door	105.0	111	104	100
8	Left Back Panel	111.1	120	115	98
9	Right Front Fender	98.7	100	96	100
10	Right Front Door	101.0	100	103	100
11	Center Panel Right				
12	Right Rear Door	110.0	105	110	115
13	Right Back Panel	104.6	103	97	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, mold on interior, possible flooding</p>