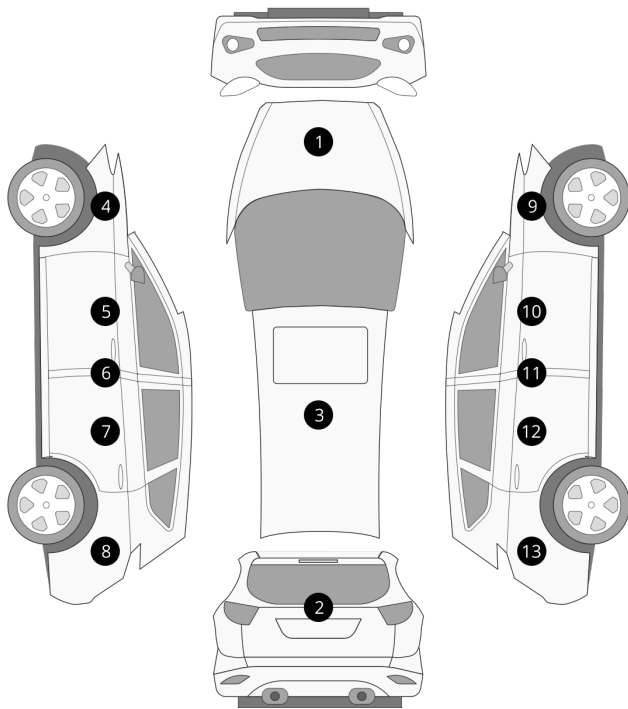


General Information

Date & Time: 30, Jul, 2025 13:49

Make	Nissan	Model	Navara
YOM	2020	Odo Meter Reading	58,442
Registration No.	KAF8630-1	Chassis No.	MNTCC2D23Z087001
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



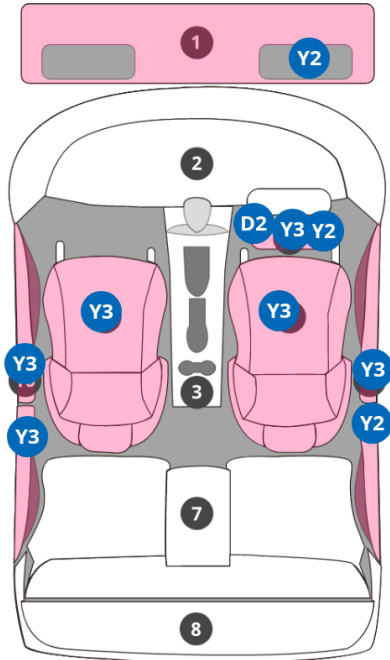
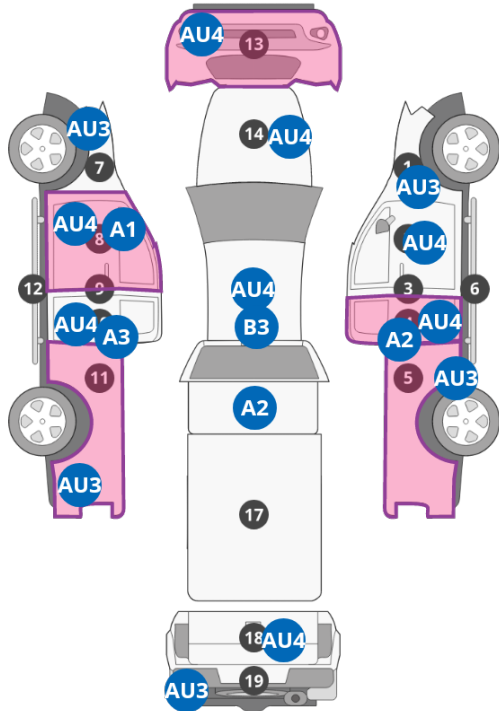
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.7	115	96	95
2	Boot Lid	90.8	93	95	85
3	Roof	78.7	78	81	74/82
4	Left Front Fender	95.3	100	94	93
5	Left Front Door	87.8	90	90	84
6	Center Panel Left				
7	Left Rear Door	85.4	87	88	81
8	Left Back Panel	86.6	75	84	101
9	Right Front Fender	343.6	737	150	144
10	Right Front Door	109.2	99	108	121
11	Center Panel Right				
12	Right Rear Door	141.0	132	150	141
13	Right Back Panel	92.6	103	86	89

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Rear Corner Panel - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Side Gate - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Side Gate - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / Cab Back Panel - Scratch - Small / Roof - Scratch & Dent - Large / Roof - Modified - Medium / (L) Mirror - Scratch - Minimal / (L) Side Gate - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Large / (R) Rear Corner Panel - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

IGNITION SWITCH ISSUE. DELAY OF TURNING OFF THE ENGINE EVEN REMOVING THE KEY AT THE IGNITION SWITCH. Crack taillight. Fog light issue. Trunk door issue cannot open properly. Sunvisor passenger side issue. Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. With LTO plate.