

General Information

Date & Time: 05, Aug, 2025 15:18

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	17,519
Registration No.	DBO1142	Chassis No.	PA1B18F37P4236402
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



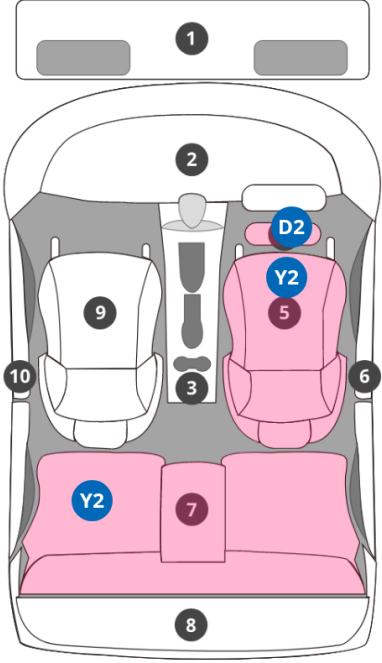
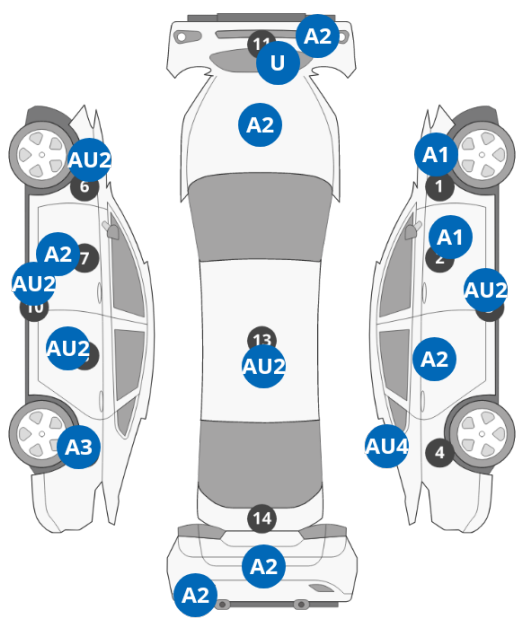
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.4	117	99	124
2	Boot Lid	118.0	104	139	111
3	Roof	103.7	104	102	100/109
4	Left Front Fender	103.0	102	106	101
5	Left Front Door	107.3	105	109	108
6	Center Panel Left				
7	Left Rear Door	105.0	110	106	99
8	Left Back Panel	117.3	115	115	122
9	Right Front Fender	106.0	111	102	105
10	Right Front Door	108.3	115	106	104
11	Center Panel Right				
12	Right Rear Door	107.6	101	105	117
13	Right Back Panel	117.3	107	109	136

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small	Remarks (R) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Spare tire and Warranty, Jack and Incomplete Tools. Crack tail light and scratch headlight and tail light.