

General Information

Date & Time: 04, Aug, 2025 10:49

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	18,041
Registration No.	NEY2860	Chassis No.	PA1B18F34R4251894
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



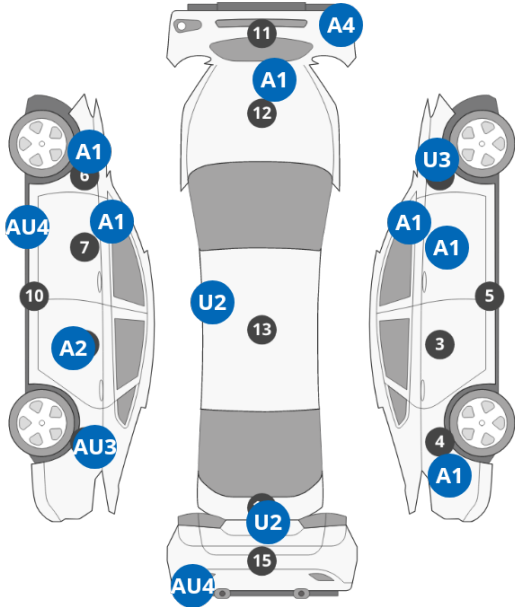
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	117	114	111
2	Boot Lid	107.6	103	105	115
3	Roof	102.8	107	104	95/105
4	Left Front Fender	105.3	108	104	104
5	Left Front Door	104.3	106	101	106
6	Center Panel Left				
7	Left Rear Door	108.3	114	109	102
8	Left Back Panel	114.0	122	107	113
9	Right Front Fender	111.0	114	110	109
10	Right Front Door	111.0	116	108	109
11	Center Panel Right				
12	Right Rear Door	104.3	100	99	114
13	Right Back Panel	106.6	101	108	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small	Remarks (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Roof - Dent - Small / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/left side tail light cover small cack/with warranty booklet/left side mirror issue/rear seat carpet dirty /