

General Information

Date & Time: 05, Aug, 2025 12:44

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	4,836
Registration No.	NKI6302	Chassis No.	PA1B18F32R4259427
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



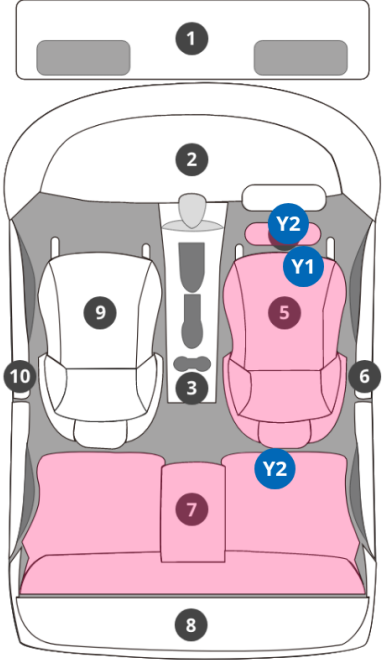
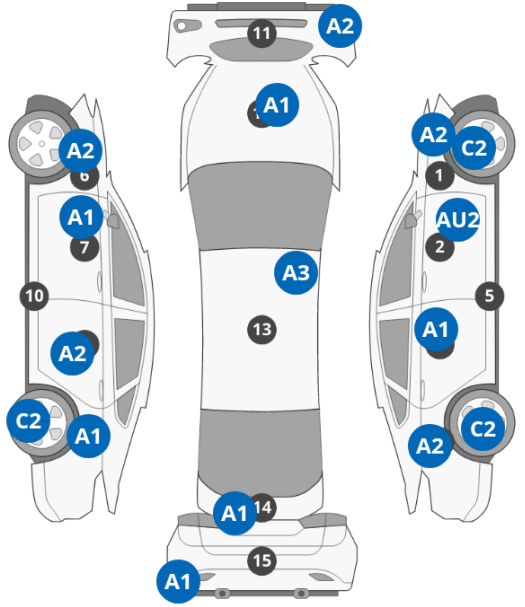
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	124	121	114
2	Boot Lid	114.6	107	114	123
3	Roof	114.7	125	112	108/114
4	Left Front Fender	109.0	102	110	115
5	Left Front Door	104.5	114	96	104
6	Center Panel Left				
7	Left Rear Door	106.6	113	100	107
8	Left Back Panel	133.0	121	120	158
9	Right Front Fender	113.0	120	106	113
10	Right Front Door	115.3	108	116	122
11	Center Panel Right				
12	Right Rear Door	108.6	104	107	115
13	Right Back Panel	114.3	115	108	120

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with warranty booklet, no jack and tools, with spare tire