

General Information

Date & Time: 04, Aug, 2025 12:47

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	26,793
Registration No.	NEY8309	Chassis No.	PA1B18F32R4265857
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



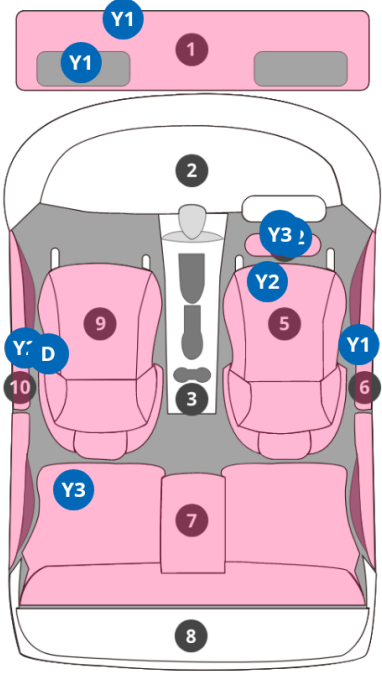
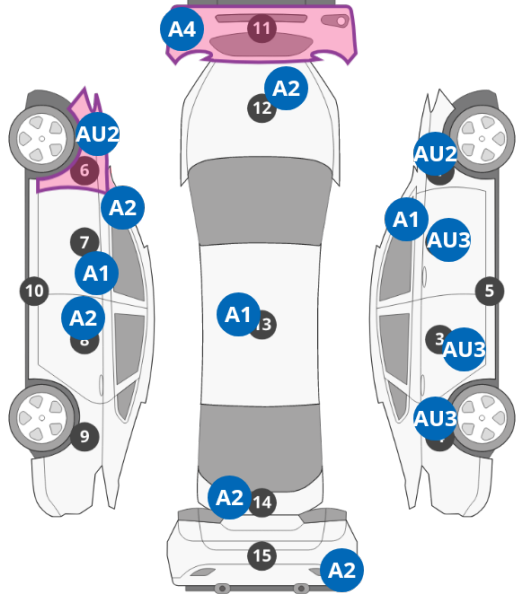
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	123	107	121
2	Boot Lid	109.6	105	109	115
3	Roof	114.7	128	105	110/116
4	Left Front Fender	97.3	98	100	94
5	Left Front Door	105.0	104	105	106
6	Center Panel Left				
7	Left Rear Door	106.2	117	112	90
8	Left Back Panel	115.3	111	118	117
9	Right Front Fender	105.3	103	104	109
10	Right Front Door	110.6	115	110	107
11	Center Panel Right				
12	Right Rear Door	108.0	100	102	122
13	Right Back Panel	113.0	110	106	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Seat - Worn - Yes / Sunvisor, Sunglass Holder - Grime - Minimal / Ceiling - Grime - Minimal / Mat Other - Grime - Medium	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, cheek light issue