

General Information

Date & Time: 01, Aug, 2025 15:48

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,090
Registration No.	DBQ5034	Chassis No.	PA1B18F37R4271539
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



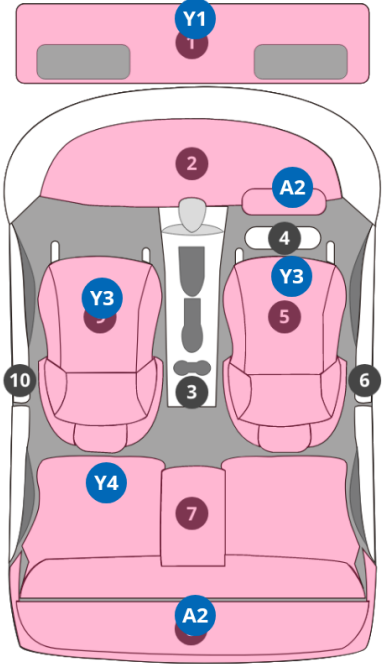
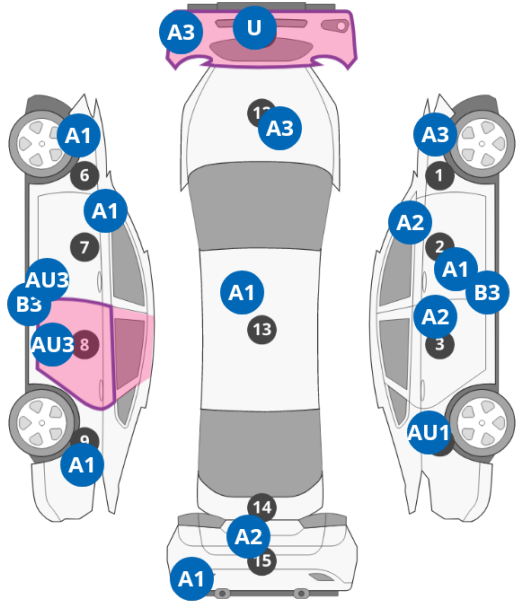
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	119	108	121
2	Boot Lid	118.6	116	109	131
3	Roof	105.0	105	109	98/108
4	Left Front Fender	111.0	107	106	120
5	Left Front Door	109.0	112	105	110
6	Center Panel Left				
7	Left Rear Door	117.0	127	112	112
8	Left Back Panel	119.6	139	114	106
9	Right Front Fender	120.0	126	126	108
10	Right Front Door	114.3	123	102	118
11	Center Panel Right				
12	Right Rear Door	114.3	105	109	129
13	Right Back Panel	117.0	119	111	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Medium / Glove Box - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Modified - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Modified - Medium / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack, no tools, with spare tire, traces of molds in interior