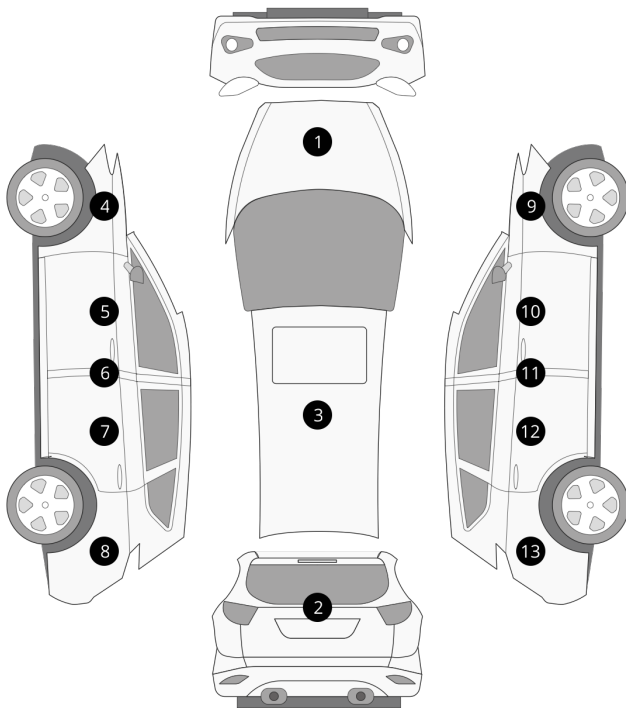


General Information

Date & Time: 01, Aug, 2025 14:02

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,623
Registration No.	NHU8285	Chassis No.	PA1B18F32R4276258
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



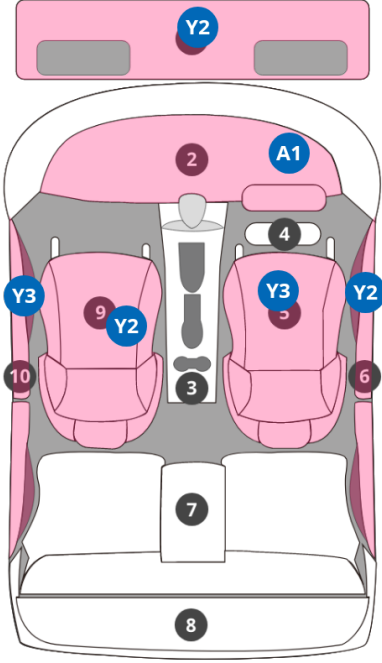
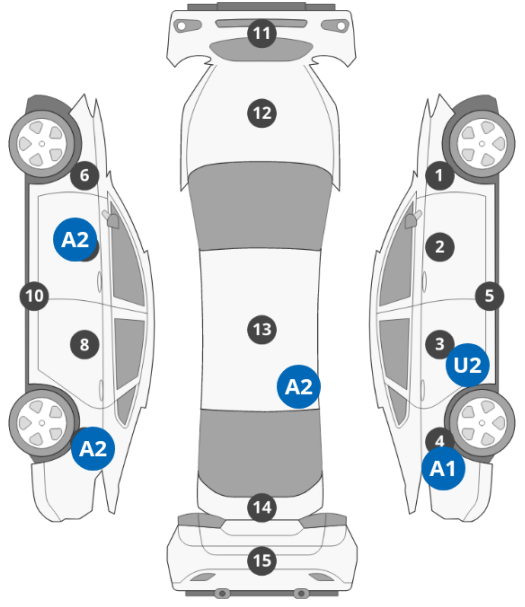
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	117	117	123
2	Boot Lid	113.3	105	119	116
3	Roof	105.3	124	96	99/102
4	Left Front Fender	105.0	105	108	102
5	Left Front Door	107.6	106	109	108
6	Center Panel Left				
7	Left Rear Door	116.0	115	115	118
8	Left Back Panel	114.0	120	111	111
9	Right Front Fender	110.0	114	109	107
10	Right Front Door	107.0	103	109	109
11	Center Panel Right				
12	Right Rear Door	111.0	116	109	108
13	Right Back Panel	113.3	107	113	120

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire /with jack and incomplete tools/no warranty booklet