

General Information

Date & Time: 16, Nov, 2024 17:20

Make	Toyota	Model	Vios
YOM	2023	Mileage	16,453
Registration No.	DBH9477	Chassis No.	PA1B18F35P4214866
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



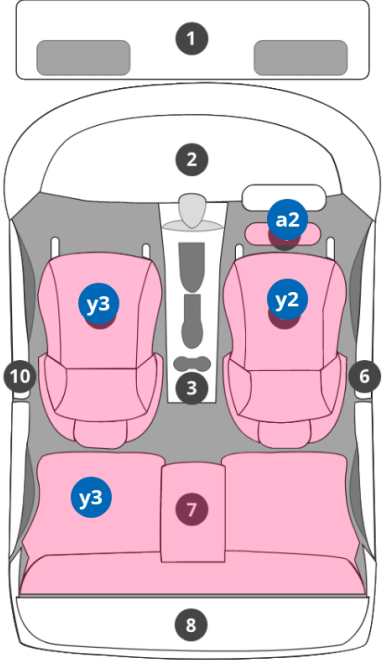
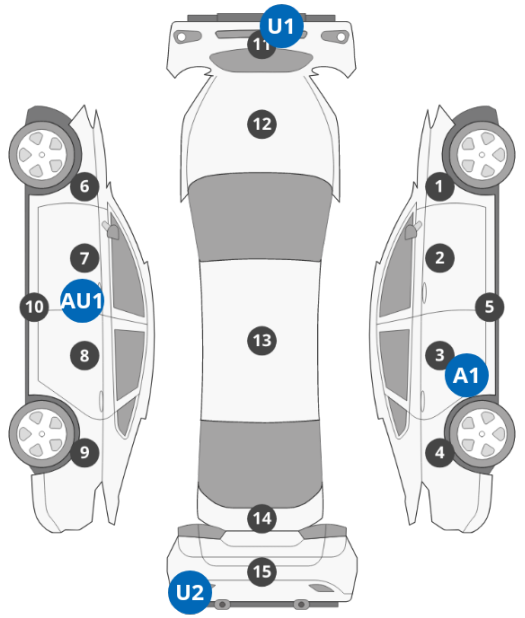
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	112	108	113
2	Boot Lid	106.0	103	104	111
3	Roof	102.9	102	97	100/113
4	Left Front Fender	102.8	103	107	99
5	Left Front Door	93.5	97	91	93
6	Center Panel Left				
7	Left Rear Door	105.6	111	106	100
8	Left Back Panel	109.0	110	110	107
9	Right Front Fender	100.8	98	103	102
10	Right Front Door	96.1	97	94	98
11	Center Panel Right				
12	Right Rear Door	102.3	101	101	105
13	Right Back Panel	99.5	97	98	104

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small	Remarks (L) Front Door, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Dent - Minimal / Rear Bumper, Lamps, Panels - Dent - Small / (R) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes

no tools. with warranty booklet and user manual. hairline scratches around the exterior.