

General Information

Date & Time: 05, Aug, 2025 10:02

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	2,425
Registration No.	DBQ6002	Chassis No.	PA2JA8EM3R0148653
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



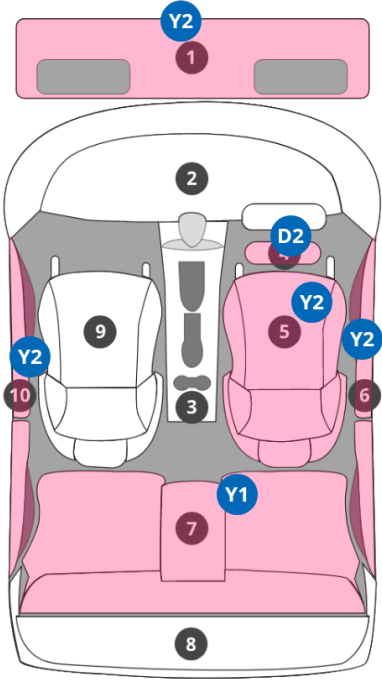
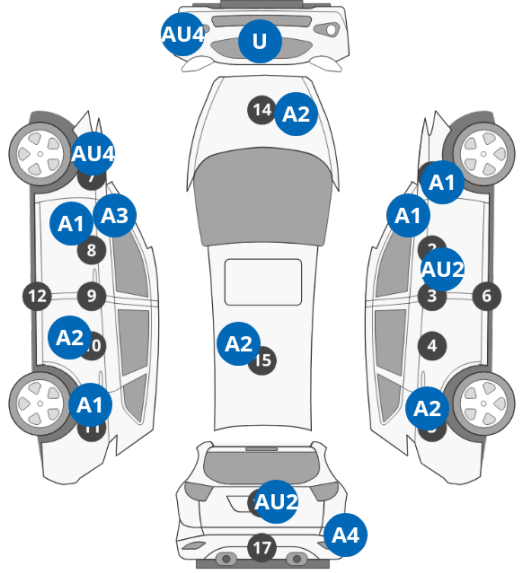
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.7	98	112	98
2	Boot Lid	95.4	97	91	98
3	Roof	90.2	94	91	81/95
4	Left Front Fender	101.6	103	102	100
5	Left Front Door	102.0	102	103	101
6	Center Panel Left				
7	Left Rear Door	99.5	100	94	105
8	Left Back Panel	110.0	109	105	116
9	Right Front Fender	91.7	88	100	88
10	Right Front Door	98.6	100	100	97
11	Center Panel Right				
12	Right Rear Door	98.6	98	100	98
13	Right Back Panel	99.4	98	104	96

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / (L) Mirror - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light