

General Information

Date & Time: 05, Aug, 2025 14:45

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	7,870
Registration No.	DBF6049	Chassis No.	PA1B18F31R4241923
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



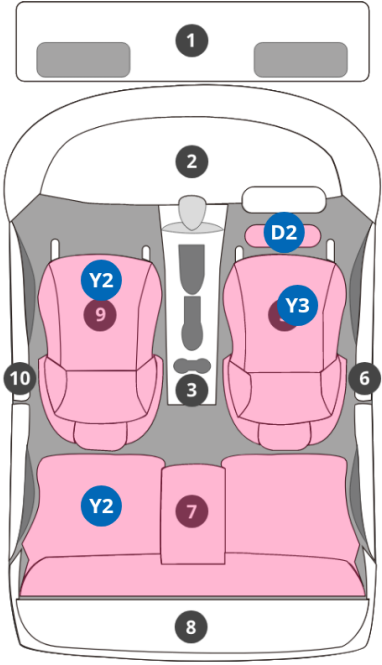
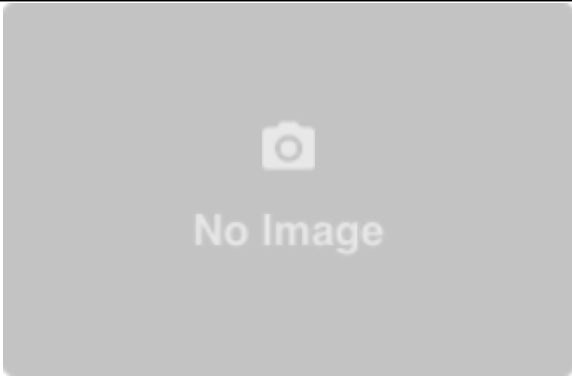
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	114	107	124
2	Boot Lid	114.3	110	118	115
3	Roof	108.7	105	112	103/115
4	Left Front Fender	103.9	104	99	109
5	Left Front Door	115.0	114	111	120
6	Center Panel Left				
7	Left Rear Door	116.3	118	117	114
8	Left Back Panel	116.6	125	118	107
9	Right Front Fender	111.0	115	109	109
10	Right Front Door	118.3	125	113	117
11	Center Panel Right				
12	Right Rear Door	121.0	112	120	131
13	Right Back Panel	119.0	114	118	125

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire , minimal stain on trunk hood,