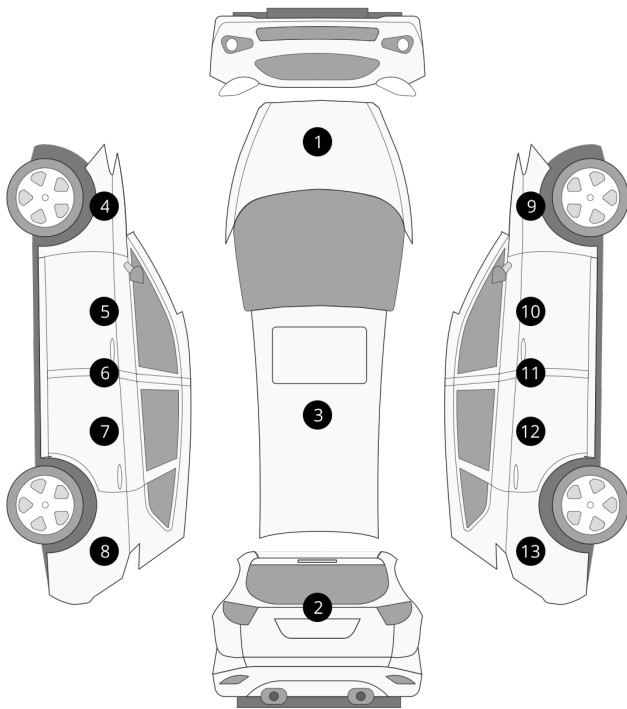


General Information

Date & Time: 31, Jul, 2025 10:37

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	125,230
Registration No.	NHI3929	Chassis No.	MHFAA12BY2P0012501
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



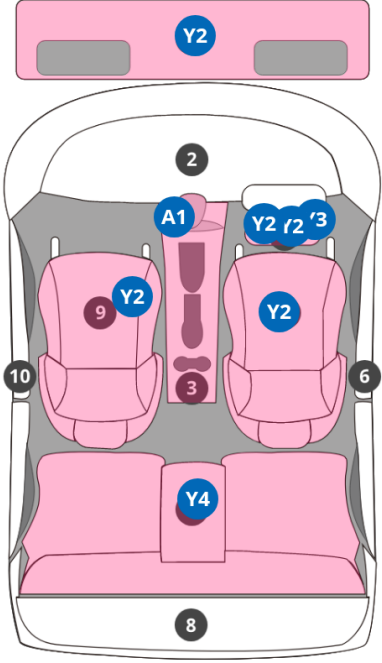
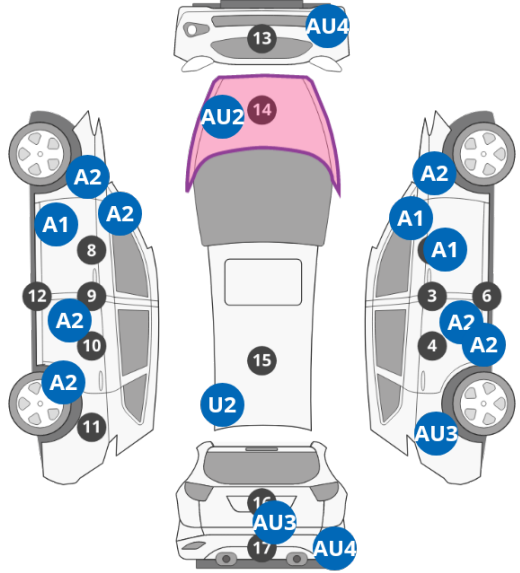
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	104	111	126
2	Boot Lid	107.7	107	125	91
3	Roof	110.0	121	100	104/115
4	Left Front Fender	102.2	94	101	112
5	Left Front Door	112.6	107	110	121
6	Center Panel Left				
7	Left Rear Door	111.6	116	108	111
8	Left Back Panel	107.6	117	102	104
9	Right Front Fender	191.0	161	260	152
10	Right Front Door	93.9	89	94	99
11	Center Panel Right				
12	Right Rear Door	173.3	170	173	177
13	Right Back Panel	130.0	121	123	146

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Large / Ceiling - Grime - Small / Mat Other - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Roof - Dent - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Power Steering - Issue - Yes

Inspector Notes
Steering issue. Rear view mirror loose. Without warranty booklet and seat cover. With spare tire and jack. Incomplete tools. 2 keys. With LTO plate.