


General Information

Date & Time: 31, Jul, 2025 15:27

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	48,798
Registration No.	EAG3124	Chassis No.	MHPE2FF2P9W22323
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition

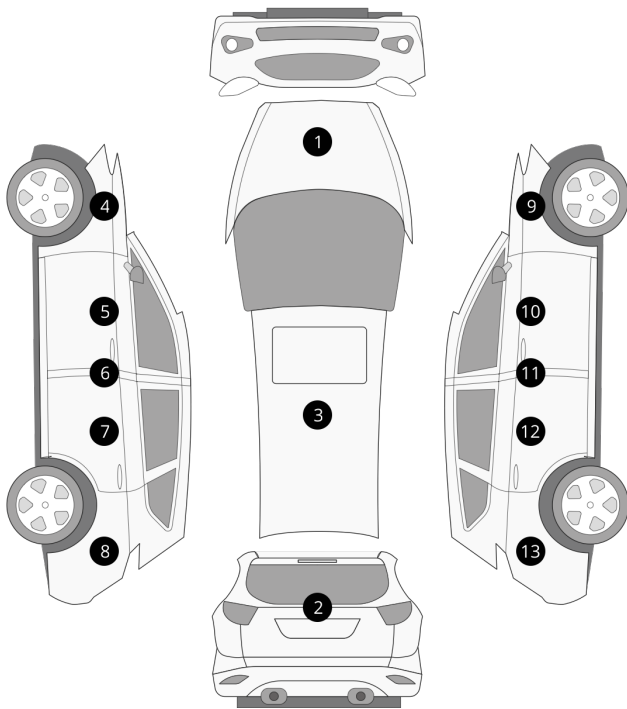

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.5	97	94	114
2	Boot Lid	114.3	117	114	112
3	Roof	106.4	112	89	116/109
4	Left Front Fender	190.6	347	113	112
5	Left Front Door	114.0	114	114	114
6	Center Panel Left				
7	Left Rear Door	115.0	116	116	113
8	Left Back Panel	117.0	116	123	112
9	Right Front Fender	106.6	106	109	105
10	Right Front Door	111.6	111	111	113
11	Center Panel Right				
12	Right Rear Door	113.6	117	114	110
13	Right Back Panel	115.0	115	115	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With warranty booklet, spare tire, jack and tools. Without seat cover. 2 keys. With LTO plate.