

General Information

Date & Time: 31, Jul, 2025 15:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	13,992
Registration No.	BAG2726	Chassis No.	PA1B18F36R4252531
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



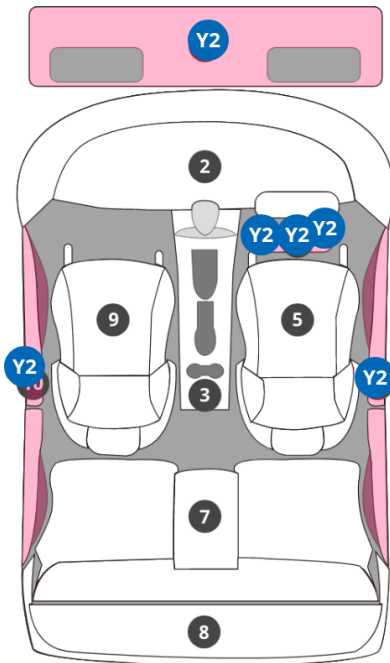
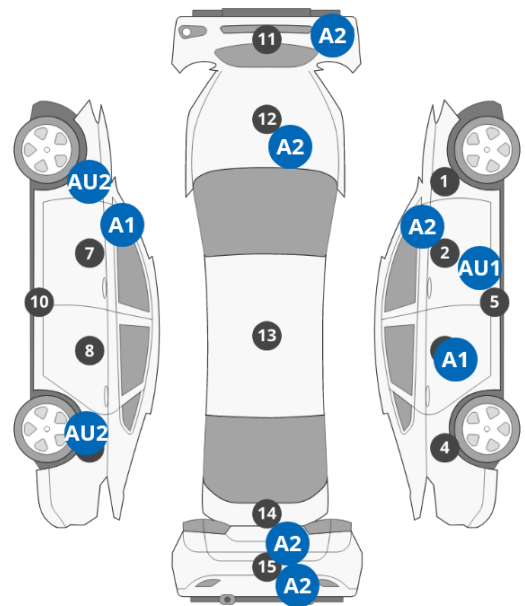
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.2	97	99	102
2	Boot Lid	98.1	99	95	100
3	Roof	94.3	101	96	90/91
4	Left Front Fender	94.7	97	95	92
5	Left Front Door	102.2	100	107	100
6	Center Panel Left				
7	Left Rear Door	97.8	96	97	101
8	Left Back Panel	105.3	108	105	103
9	Right Front Fender	94.1	94	97	92
10	Right Front Door	100.5	102	100	100
11	Center Panel Right				
12	Right Rear Door	100.6	101	100	101
13	Right Back Panel	102.6	99	102	107

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

USB aux cover missing at radio. minimal hole at radio. Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. With LTO plate.