


General Information

Date & Time: 01, Aug, 2025 08:08

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	19,802
Registration No.	CCG4167	Chassis No.	PA1B18F36R4269037
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition

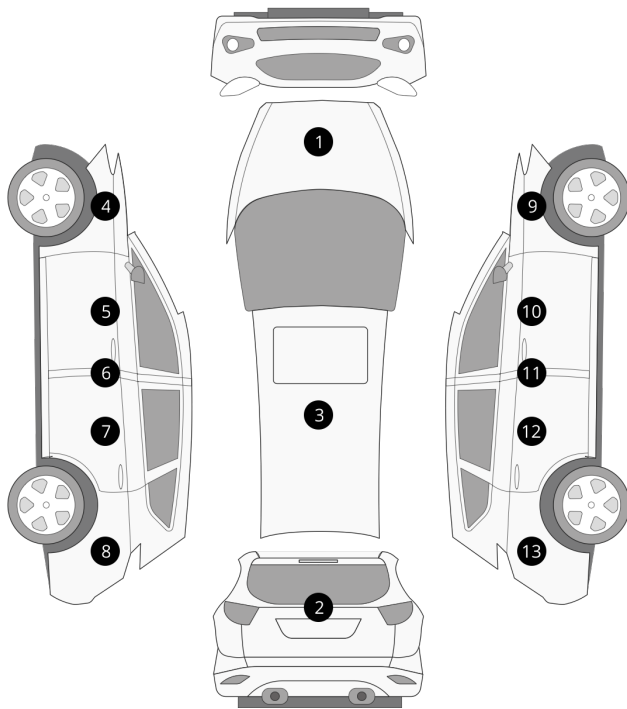

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.2	104	99	104
2	Boot Lid	100.7	98	99	105
3	Roof	98.6	105	103	92/95
4	Left Front Fender	92.8	98	92	89
5	Left Front Door	100.5	96	105	101
6	Center Panel Left				
7	Left Rear Door	105.0	111	106	98
8	Left Back Panel	106.3	116	100	103
9	Right Front Fender	94.8	93	94	98
10	Right Front Door	97.3	100	97	95
11	Center Panel Right				
12	Right Rear Door	97.6	96	96	101
13	Right Back Panel	104.2	103	97	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Mirror - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
Low battery. No reverse light. Gap at rear bumper. With warranty booklet, spare tire, jack, tools and seat cover. 1 key. With LTO plate.