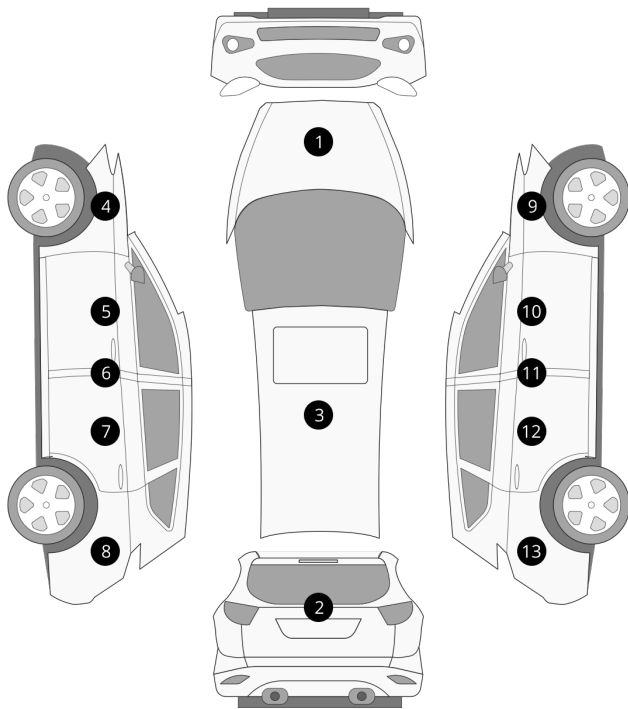


General Information

Date & Time: 01, Aug, 2025 18:30

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	125,230
Registration No.	BAG3929	Chassis No.	PA2JA8EM2R0142097
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



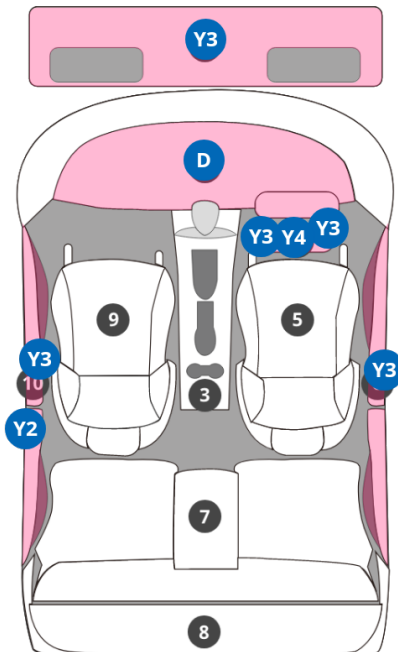
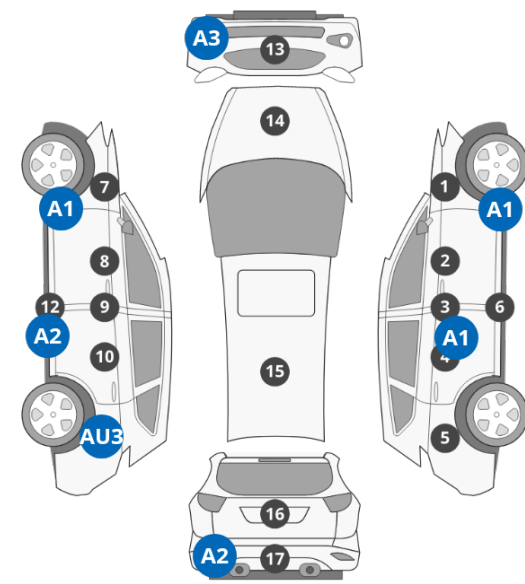
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	116	116	122
2	Boot Lid	98.8	101	93	103
3	Roof	98.3	107	90	102/94
4	Left Front Fender	97.0	109	96	86
5	Left Front Door	101.0	100	104	99
6	Center Panel Left				
7	Left Rear Door	104.1	108	107	98
8	Left Back Panel	100.5	102	98	102
9	Right Front Fender	96.2	87	99	103
10	Right Front Door	99.0	100	100	97
11	Center Panel Right				
12	Right Rear Door	93.3	83	95	102
13	Right Back Panel	100.4	103	101	97

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Large / Ceiling - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium	Remarks (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

Low battery. Crack and scratches on taillight. Sccratches on wheel cap. With warranty booklet, spare tire and seat cover. Without jack and tools. 2 keys. with LTO plate.