

General Information

Date & Time: 06, Aug, 2025 14:37

Make	Hino	Model	315
YOM	2024	Odo Meter Reading	16,669
Registration No.	DBS9598	Chassis No.	JHHAGP6E3RK004456
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Aluminum Van
Colour	White		

Body / Panel Condition



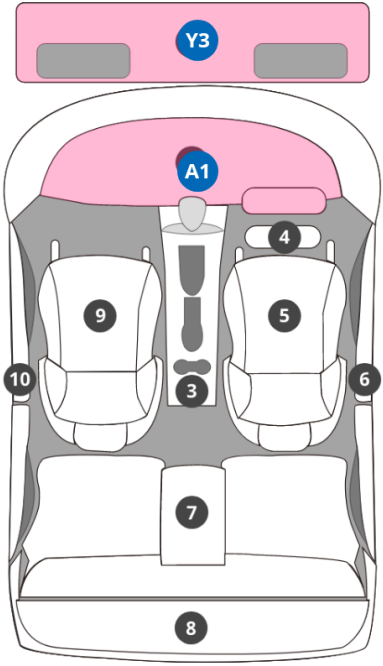
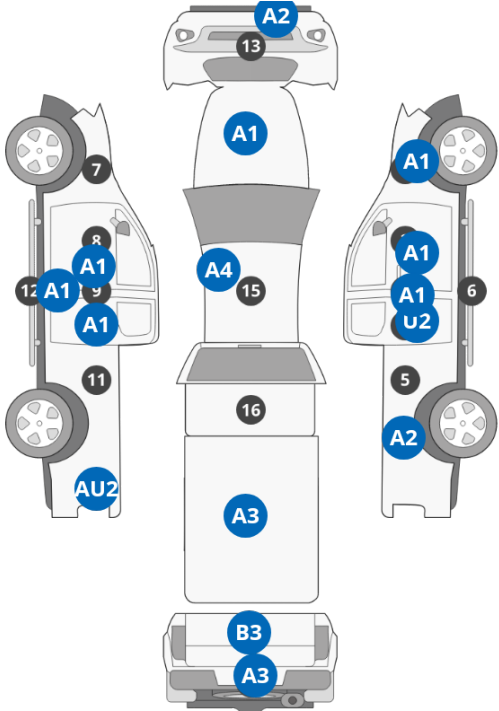
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	68.4	67	69	70
2	Boot Lid	116.6	100	102	148
3	Roof	87.2	85	81	100/83
4	Left Front Fender	66.8	67	67	67
5	Left Front Door	80.7	75	82	85
6	Center Panel Left	95.7	92	96	99
7	Left Rear Door	83.2	87	82	81
8	Left Back Panel	95.6	84	78	125
9	Right Front Fender	77.7	80	79	74
10	Right Front Door	74.7	81	70	73
11	Center Panel Right	96.0	92	105	92
12	Right Rear Door	148.3	133	143	169
13	Right Back Panel	126.3	125	125	129

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Medium</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Small / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Cargo Bed Floor - Scratch - Medium / (L) Side Gate - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Minimal / Roof - Scratch - Large / Rear Gate - Modified - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, no jack, with incomplete tools, with spare tire, scratches on tail light</p>