

General Information

Date & Time: 05, Aug, 2025 17:28

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	12,882
Registration No.	NHQ5201	Chassis No.	PA2JA8EM8R0139124
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



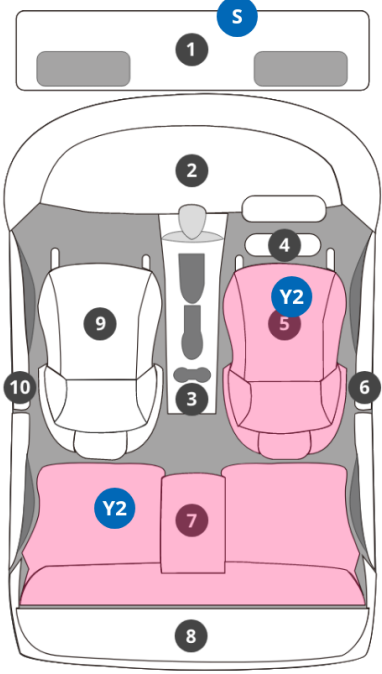
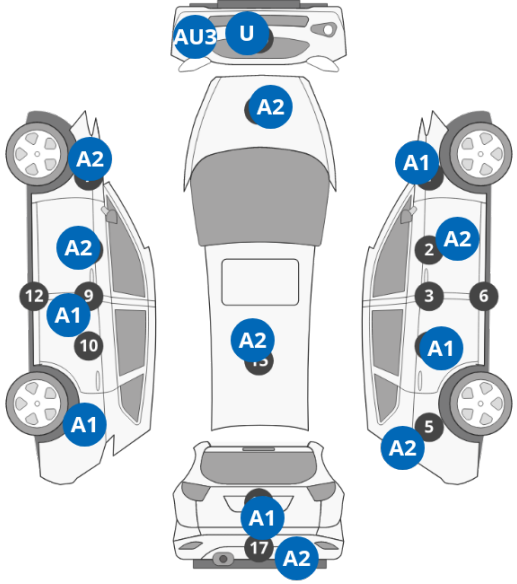
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	112	121	125
2	Boot Lid	107.0	111	107	103
3	Roof	106.7	95	101	115/116
4	Left Front Fender	109.6	113	107	109
5	Left Front Door	106.6	100	107	113
6	Center Panel Left				
7	Left Rear Door	106.6	106	107	107
8	Left Back Panel	109.6	108	112	109
9	Right Front Fender	107.1	100	102	120
10	Right Front Door	106.0	101	114	103
11	Center Panel Right				
12	Right Rear Door	108.3	113	109	103
13	Right Back Panel	104.4	98	109	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / Overall Interior - Smell - Yes	Remarks (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire and Jack and Incomplete Tools, with warranty booklet, Scratch headlight and tail light.