

## General Information

Date & Time: 01, Aug, 2025 13:16

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	19,776
<b>Registration No.</b>	NHU8272	<b>Chassis No.</b>	PA2JA8EMXR0151744
<b>CC</b>	2.8	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	Black		

## Body / Panel Condition



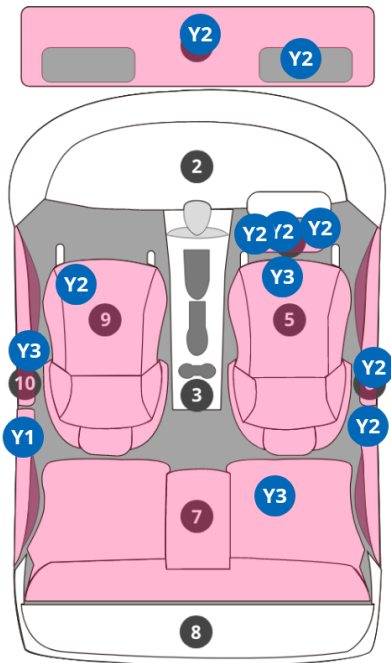
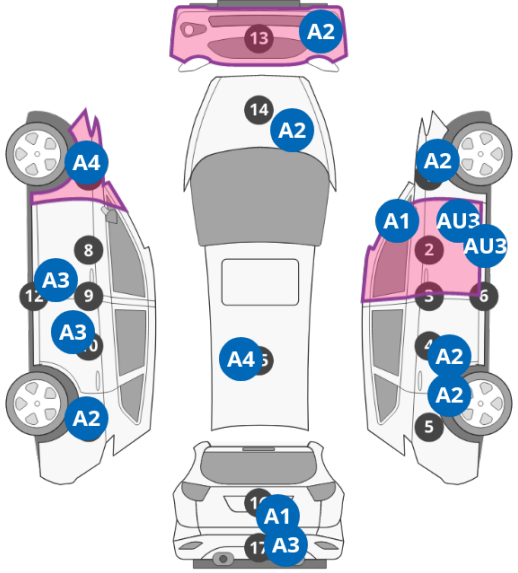
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	120	113	126
2	Boot Lid	144.3	148	136	149
3	Roof	154.0	163	145	155/153
4	Left Front Fender	337.6	676	174	163
5	Left Front Door	163.0	166	169	154
6	Center Panel Left				
7	Left Rear Door	157.3	150	164	158
8	Left Back Panel	155.6	164	142	161
9	Right Front Fender	163.6	164	166	161
10	Right Front Door	160.3	153	165	163
11	Center Panel Right				
12	Right Rear Door	160.3	152	164	165
13	Right Back Panel	172.0	171	172	173

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / Mat Other - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet,tools,jack and seat cover. With spare tire. 2 key. With LTO plate.</p>