

General Information

Date & Time: 16, Nov, 2024 17:40

Make	Toyota	Model	Vios
YOM	2024	Mileage	10,169
Registration No.	NHH5366	Chassis No.	PA1B18F33R4252020
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



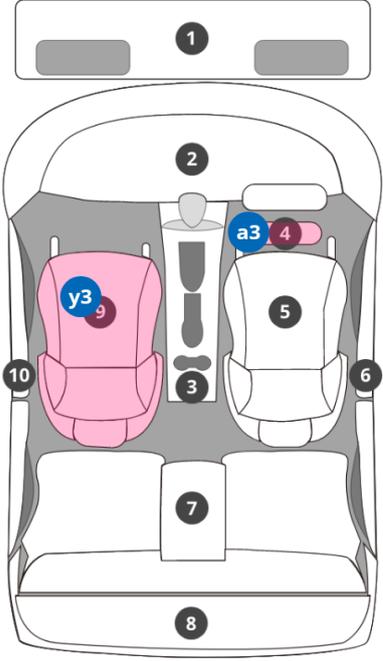
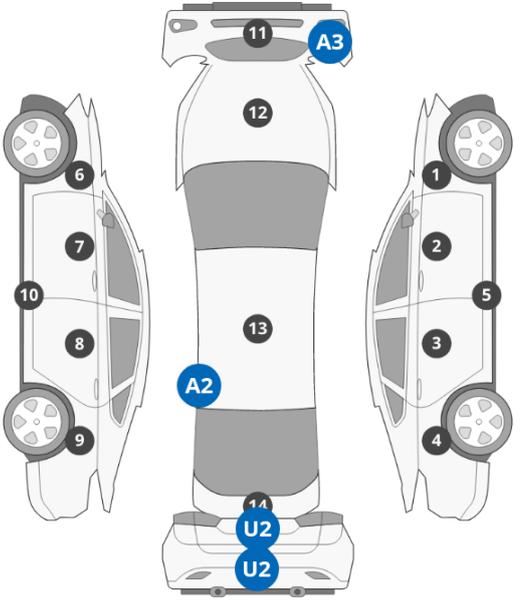
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	134	118	123
2	Boot Lid	122.3	121	121	125
3	Roof	114.5	124	109	109/116
4	Left Front Fender	110.6	110	106	116
5	Left Front Door	112.0	109	121	106
6	Center Panel Left				
7	Left Rear Door	120.6	121	121	120
8	Left Back Panel	127.3	136	118	128
9	Right Front Fender	111.6	118	107	110
10	Right Front Door	110.0	108	110	112
11	Center Panel Right				
12	Right Rear Door	115.3	112	118	116
13	Right Back Panel	117.0	114	114	123

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium</p>	<p>Remarks Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet/ with jack and tools/ with spare tire</p>