

General Information

Date & Time: 05, Aug, 2025 16:19

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	57,841
Registration No.	NHR1931	Chassis No.	PA1B18F30P4227203
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



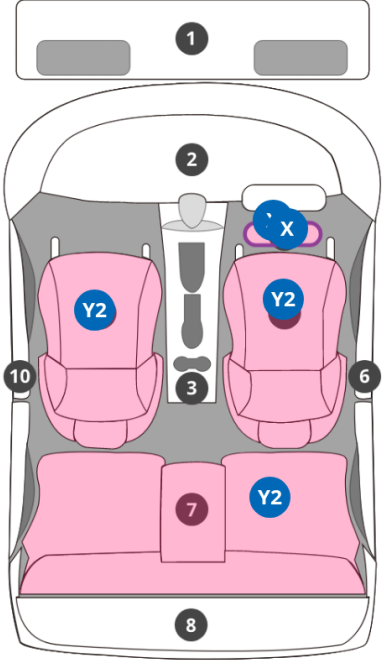
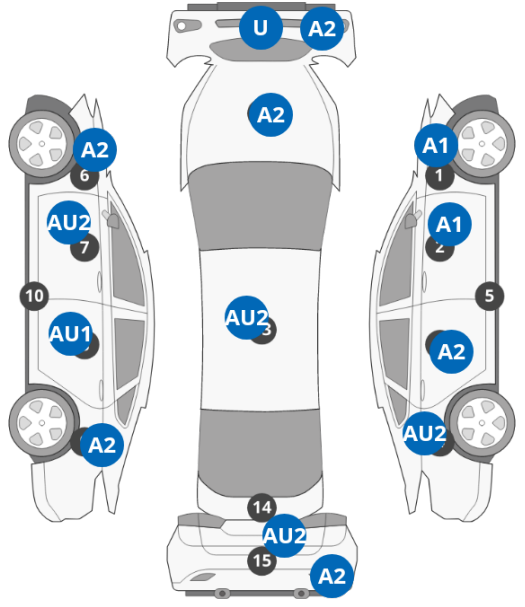
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	120	115	108
2	Boot Lid	115.0	109	117	119
3	Roof	109.0	110	113	104/109
4	Left Front Fender	101.6	103	100	102
5	Left Front Door	102.0	105	98	103
6	Center Panel Left				
7	Left Rear Door	108.0	115	105	104
8	Left Back Panel	108.6	111	108	107
9	Right Front Fender	98.3	96	101	98
10	Right Front Door	100.6	99	101	102
11	Center Panel Right				
12	Right Rear Door	110.6	109	108	115
13	Right Back Panel	109.6	106	106	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Small	Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, Incomplete Tools and Jack. no warranty booklet and Crack tail light and scratch headlight and tail light and worn tires.