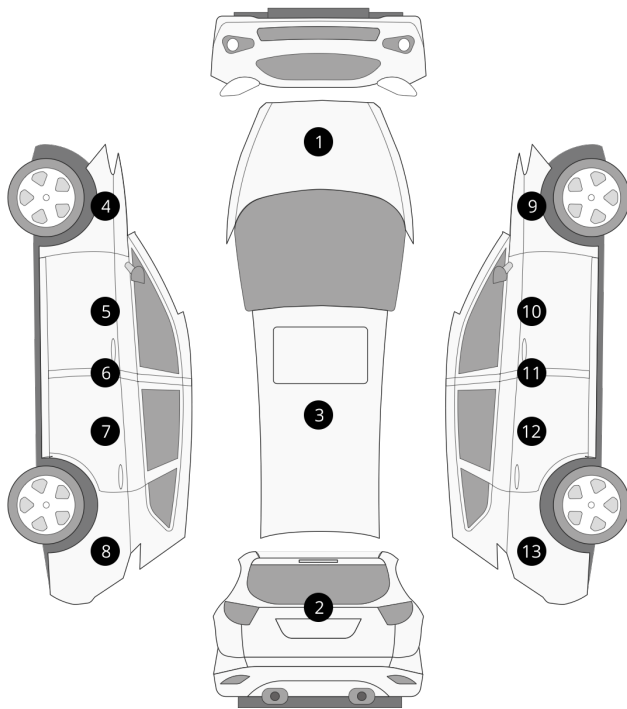


General Information

Date & Time: 13, Aug, 2025 08:00

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	1,234
Registration No.	BAG3721	Chassis No.	PA1B18F3XR4258509
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



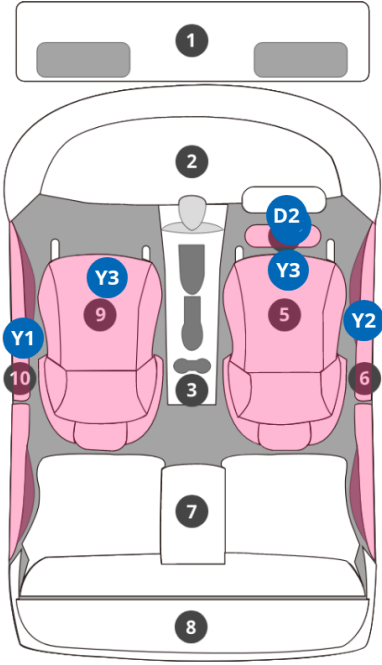
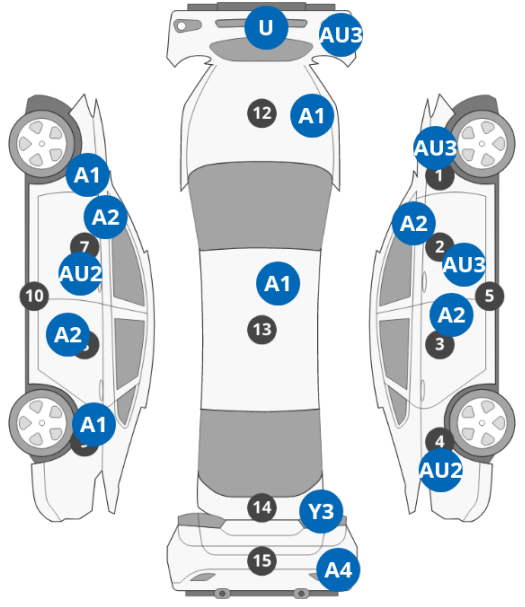
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	119	109	133
2	Boot Lid	115.0	110	114	121
3	Roof	107.1	114	110	98/107
4	Left Front Fender	103.4	102	110	98
5	Left Front Door	112.6	112	111	115
6	Center Panel Left				
7	Left Rear Door	107.8	118	106	99
8	Left Back Panel	112.3	122	113	102
9	Right Front Fender	108.6	109	101	116
10	Right Front Door	111.6	114	109	112
11	Center Panel Right				
12	Right Rear Door	111.0	103	109	121
13	Right Back Panel	107.9	100	113	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, no jack, with tools, with spare tire, with LTO plate, no keys, functional and mileage can't verify due to no keys