

General Information

Date & Time: 31, Jul, 2025 18:05

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	48,868
Registration No.	NIF8723	Chassis No.	PA1B18F3XN4195891
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



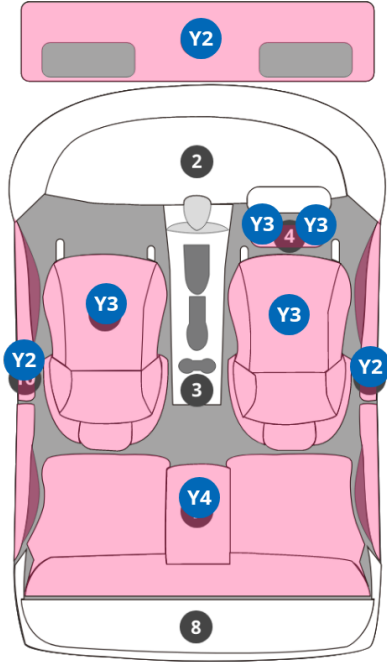
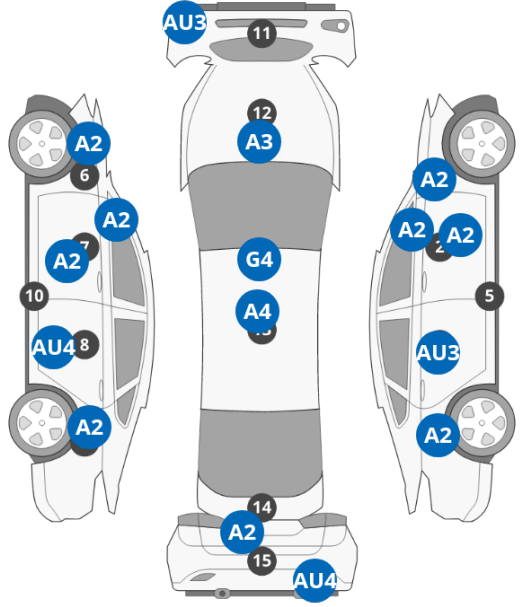
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	98	100	104
2	Boot Lid	104.5	100	105	109
3	Roof	94.5	95	92	94/98
4	Left Front Fender	261.6	214	263	308
5	Left Front Door	140.0	166	128	126
6	Center Panel Left				
7	Left Rear Door	100.8	108	100	95
8	Left Back Panel	105.9	121	92	105
9	Right Front Fender	99.7	99	100	100
10	Right Front Door	101.3	98	102	104
11	Center Panel Right				
12	Right Rear Door	105.6	107	108	102
13	Right Back Panel	109.3	105	107	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / Front Windshield - Scratch, Stone chip - Large / Roof - Scratch - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
Scratch on front windshield. Scratches on taillights. With warranty booklet and jack. Without spare tire, tools, and seat cover. 1 key. With LTO plate.