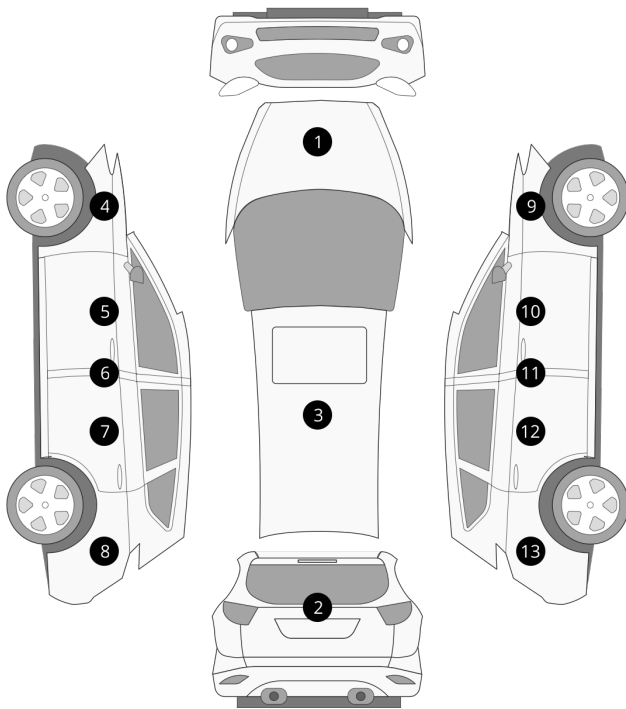


General Information

Date & Time: 01, Aug, 2025 08:29

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	16,044
Registration No.	NHM7092	Chassis No.	PA2JA8EM5P0131995
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



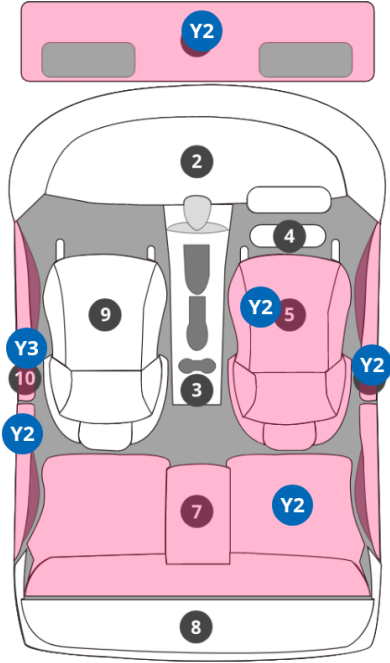
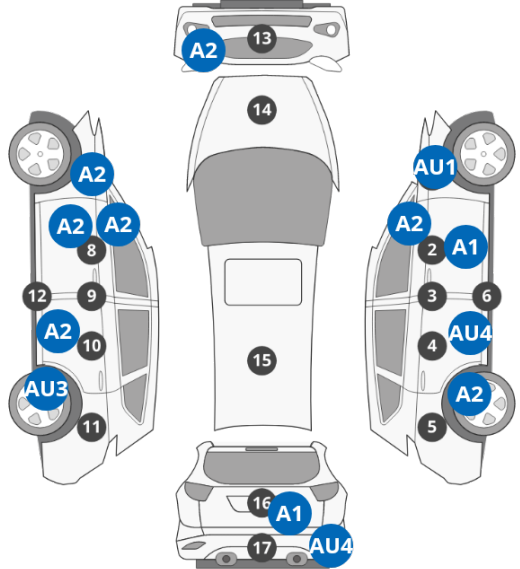
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	109	116	108
2	Boot Lid	93.2	95	87	98
3	Roof	90.5	86	81	101/94
4	Left Front Fender	93.7	99	97	85
5	Left Front Door	94.3	95	97	91
6	Center Panel Left				
7	Left Rear Door	100.4	104	101	96
8	Left Back Panel	102.6	102	101	105
9	Right Front Fender	96.7	88	101	101
10	Right Front Door	96.7	95	101	94
11	Center Panel Right				
12	Right Rear Door	97.6	95	100	98
13	Right Back Panel	105.3	108	100	108

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Trim Other - Grime - Small / (L) Front Trim - Grime - Medium	Remarks (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

Gap at front bumper. Without warranty booklet. With Spare tire,jack,tools and seat cover. 2 keys. With LTO plate.