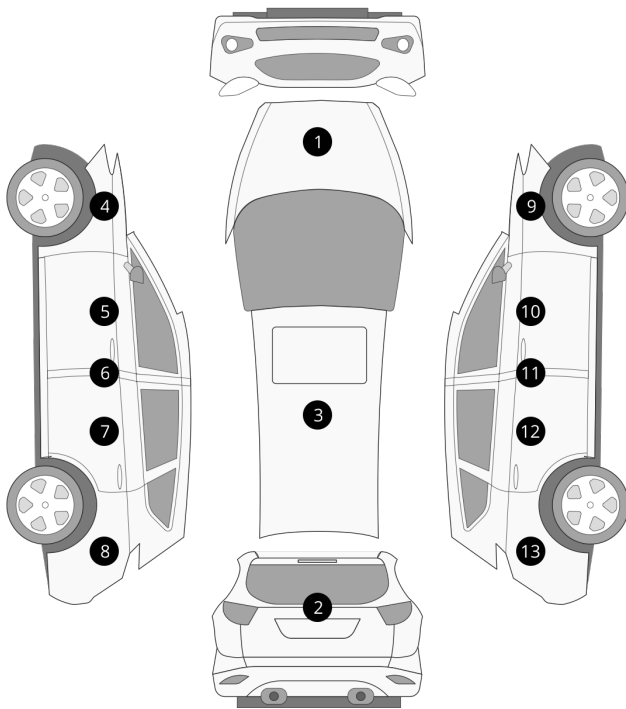


General Information

Date & Time: 01, Aug, 2025 18:48

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,632
Registration No.	CCG4869	Chassis No.	PA1B18F634R4269179
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



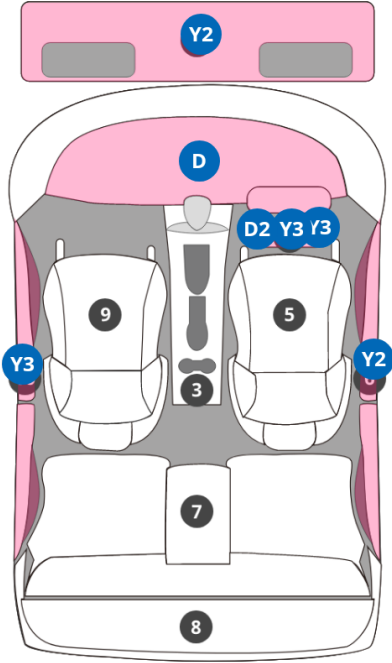
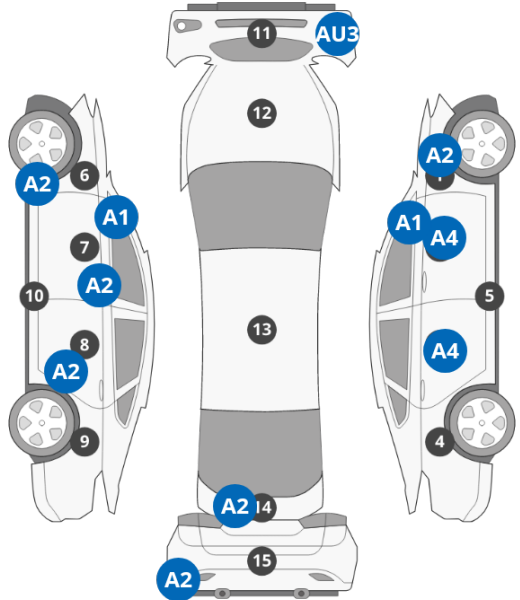
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.7	102	98	102
2	Boot Lid	103.8	100	103	109
3	Roof	93.1	96	90	86/101
4	Left Front Fender	94.3	101	92	90
5	Left Front Door	96.8	97	95	98
6	Center Panel Left				
7	Left Rear Door	100.5	109	98	94
8	Left Back Panel	101.8	107	100	99
9	Right Front Fender	90.7	90	89	94
10	Right Front Door	93.7	96	93	92
11	Center Panel Right				
12	Right Rear Door	95.5	90	91	105
13	Right Back Panel	99.6	99	96	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
Low battery. With warranty booklet, spare tire, jack, tools and seat cover. 1 key. With LTO plate.