

General Information

Date & Time: 16, Nov, 2024 12:45

Make	Toyota	Model	Wigo
YOM	2023	Mileage	29,802
Registration No.	CCA2966	Chassis No.	MHKAA1BC2PJ003992
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



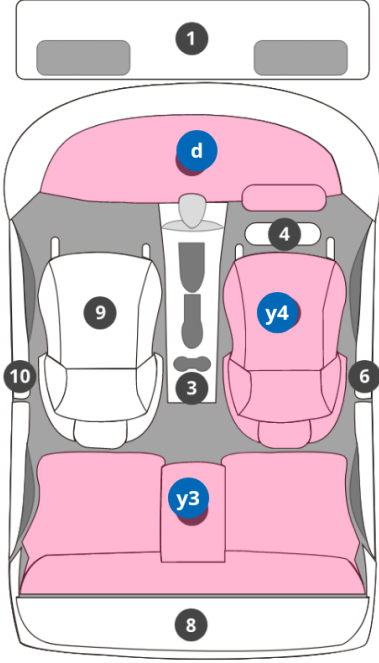
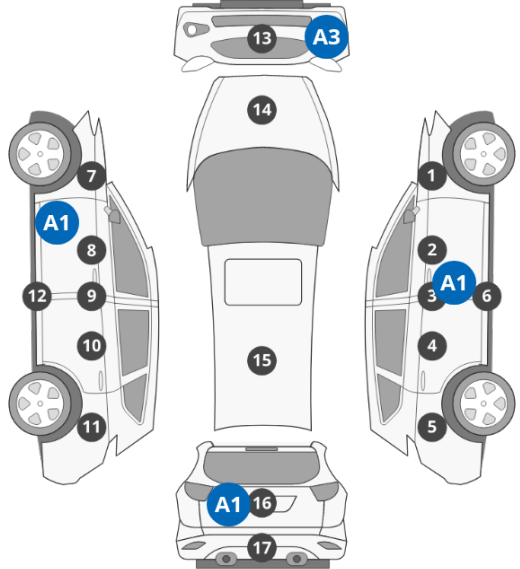
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	115	111	112
2	Boot Lid	99.3	95	100	103
3	Roof	90.9	85	99	86/94
4	Left Front Fender	109.0	108	107	112
5	Left Front Door	115.0	108	112	125
6	Center Panel Left				
7	Left Rear Door	109.1	121	109	97
8	Left Back Panel	101.3	104	98	102
9	Right Front Fender	103.5	108	104	99
10	Right Front Door	103.1	109	103	98
11	Center Panel Right				
12	Right Rear Door	106.6	101	106	113
13	Right Back Panel	101.5	101	100	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Large	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

hairline scratches around the exterior.