

General Information

Date & Time: 01, Aug, 2025 14:52

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	65,008
Registration No.	DBB5700	Chassis No.	PA1B18F32P4200987
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



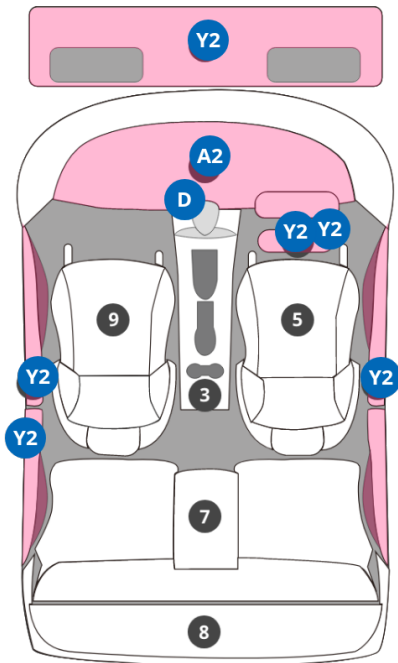
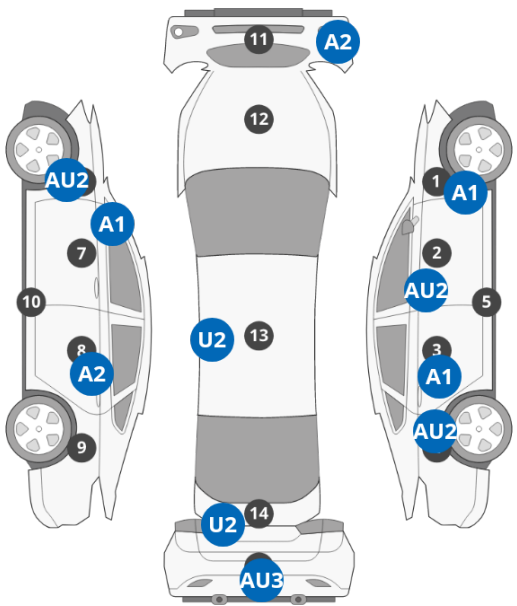
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	104	104	107
2	Boot Lid	105.6	103	101	113
3	Roof	94.9	102	86	94/98
4	Left Front Fender	99.2	107	99	92
5	Left Front Door	106.3	109	108	102
6	Center Panel Left				
7	Left Rear Door	109.0	115	106	106
8	Left Back Panel	114.3	121	107	115
9	Right Front Fender	107.3	112	107	103
10	Right Front Door	100.4	100	102	99
11	Center Panel Right				
12	Right Rear Door	107.6	101	108	114
13	Right Back Panel	102.3	102	100	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Rear Trim - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Foglight issue. Interior light issue. Without warranty booklet,jack and tools. With spare tire and seat cover. 1 key. With LTO plate.