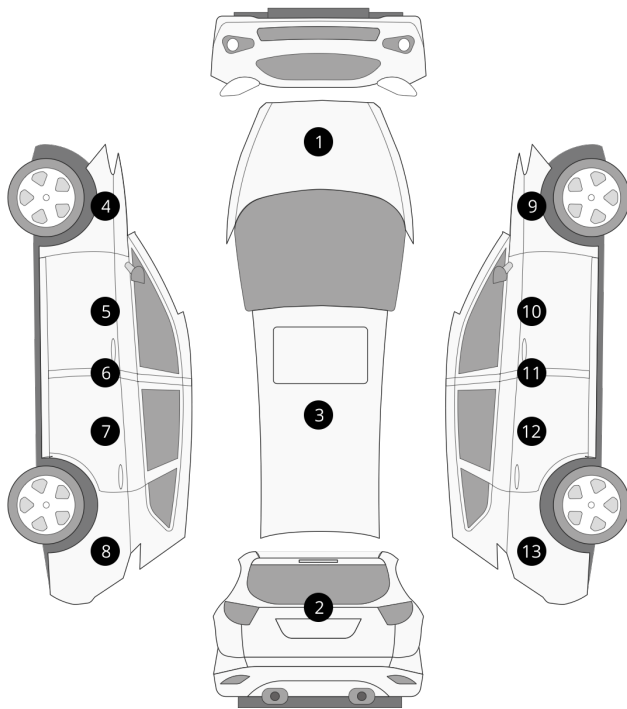


General Information

Date & Time: 07, Aug, 2025 08:54

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	16,939
Registration No.	DBJ9818	Chassis No.	PA1B18F35P4227682
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



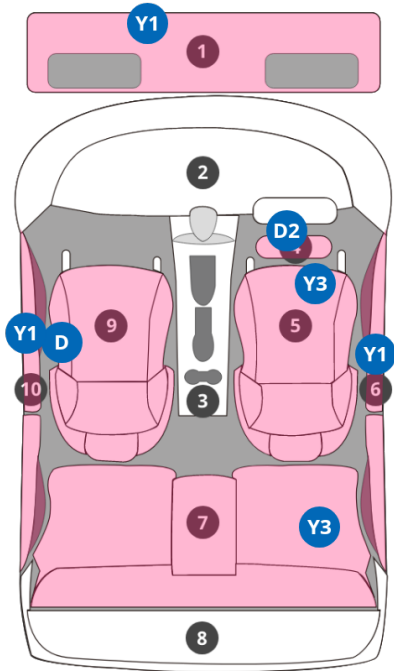
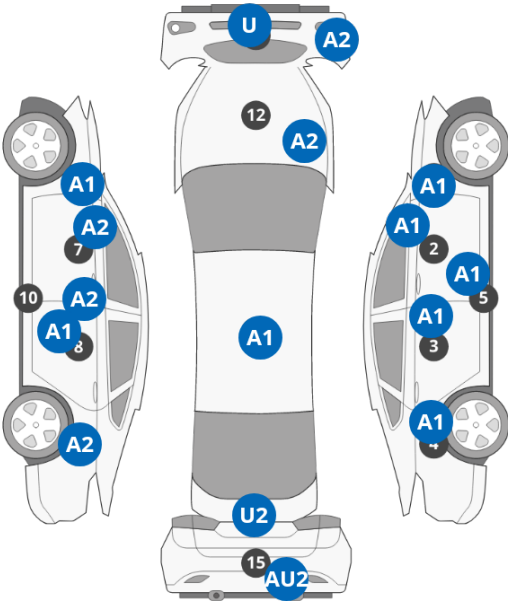
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	115	116	119
2	Boot Lid	137.0	134	144	133
3	Roof	110.7	112	108	108/115
4	Left Front Fender	116.3	135	112	102
5	Left Front Door	105.6	101	109	107
6	Center Panel Left				
7	Left Rear Door	108.3	116	106	103
8	Left Back Panel	117.6	129	113	111
9	Right Front Fender	121.0	123	119	121
10	Right Front Door	120.0	119	122	119
11	Center Panel Right				
12	Right Rear Door	118.0	112	115	127
13	Right Back Panel	120.3	106	127	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal		Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : B	
Remarks Defects not found		Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on tail light