

General Information

Date & Time: 06, Aug, 2025 16:03

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,308
Registration No.	NEY2870	Chassis No.	PA1B18F38R4251817
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



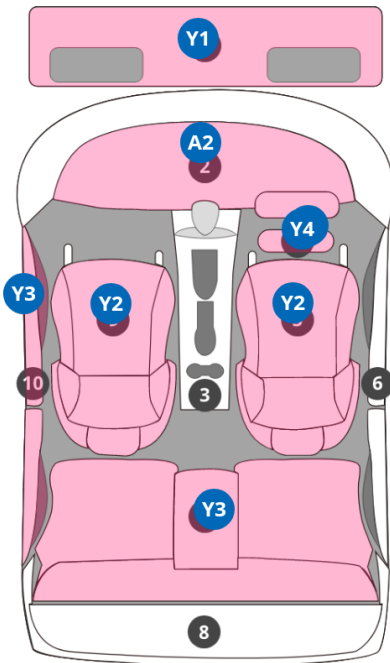
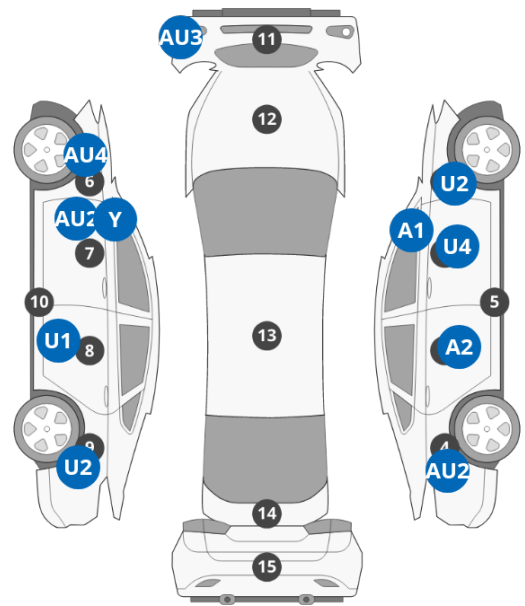
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	118	116	113
2	Boot Lid	107.0	102	108	111
3	Roof	98.1	104	92	94/103
4	Left Front Fender	100.5	102	99	101
5	Left Front Door	101.3	100	102	102
6	Center Panel Left				
7	Left Rear Door	109.6	110	105	114
8	Left Back Panel	108.0	111	106	107
9	Right Front Fender	109.0	110	110	107
10	Right Front Door	104.9	100	105	110
11	Center Panel Right				
12	Right Rear Door	109.6	104	114	111
13	Right Back Panel	104.3	99	102	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Minimal / Mat Other - Grime - Large	Remarks (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Crack - Damaged / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/No jack and tools/with warranty booklet/left side mirror issue/with spare key/with reverse camera