

General Information

Date & Time: 07, Aug, 2025 13:57

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	25,965
Registration No.	NHI8700	Chassis No.	MHKU3FE10PK003755
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



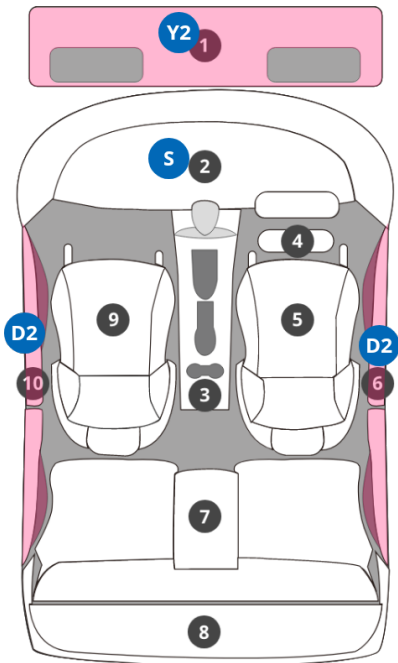
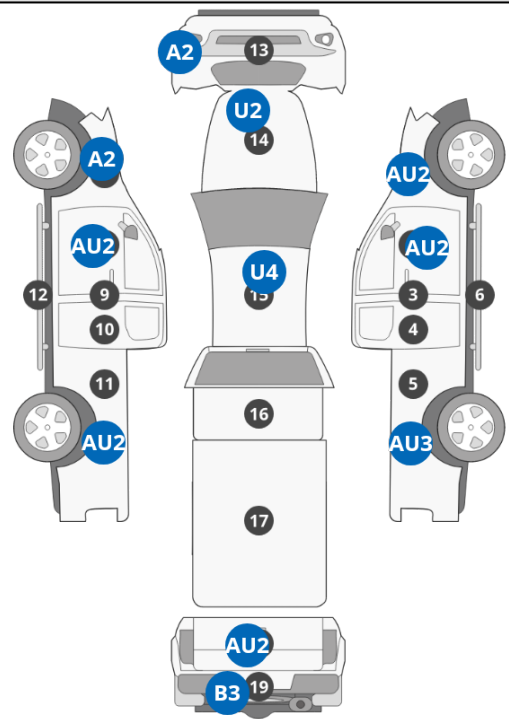
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	56.2	56	61	52
2	Boot Lid	60.5	76	53	53
3	Roof	58.2	65	51	67/50
4	Left Front Fender	53.3	50	50	61
5	Left Front Door	60.8	67	58	57
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	68.0	59	73	72
9	Right Front Fender	70.2	84	69	57
10	Right Front Door	55.6	51	55	62
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	71.3	65	59	90

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Small	Remarks (L) Side Gate - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Modified - Medium / Roof - Dent - Large / Rear Gate - Scratch & Dent - Small / Bonnet, Headlight - Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate and sparetire. No Tools/ jack/ warranty booklet/No reverse cam/ modified rear step board/ Clutch lining issue.