

General Information

Date & Time: 04, Aug, 2025 08:41

Make	Hyundai	Model	Elantra
YOM	2019	Odo Meter Reading	69,991
Registration No.	NEH3987	Chassis No.	KMHD741CAJU649475
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



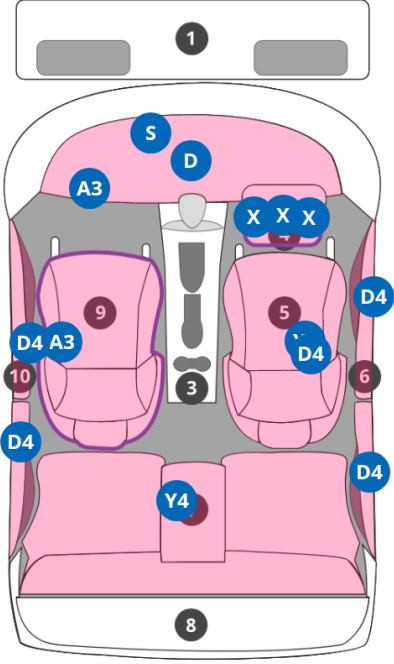
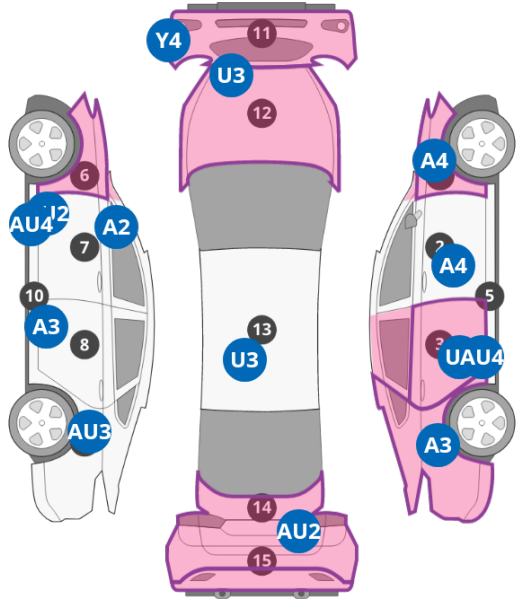
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	175.3	183	186	157
2	Boot Lid	108.3	113	105	107
3	Roof	106.7	101	112	116/98
4	Left Front Fender	330.6	274	532	186
5	Left Front Door	105.0	103	112	100
6	Center Panel Left				
7	Left Rear Door	104.3	102	107	104
8	Left Back Panel	96.7	95	89	106
9	Right Front Fender	393.6	644	364	173
10	Right Front Door	374.6	790	169	165
11	Center Panel Right				
12	Right Rear Door	182.0	172	175	199
13	Right Back Panel	189.6	240	162	167

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Cut, Crack - Medium / (L) Front Seat Knobs - Partially Missing - Yes / (L) Front Seat Knobs - Stuck - Yes / (L) Front Trim - Worked - Large / (L) Rear Trim - Worked - Large / Rear Seat - Grime - Large / (R) Rear Trim - Worked - Large / (R) Front Trim - Worked - Large / (R) Front Seat - Grime - Large / (R) Front Seat belt - Loose, Deformed - Large / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Partially Missing - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Door Lock - Issue - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

with LTO PLATE And warranty booklet/ with spare tire/ no tools/ no jack/ no rear right door handle/ possible flooding/no backseat cover / scratches on yellowish headlight/