

General Information

Date & Time: 07, Aug, 2025 09:29

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	56,249
Registration No.	NHR4339	Chassis No.	PA1B18F38P4230124
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



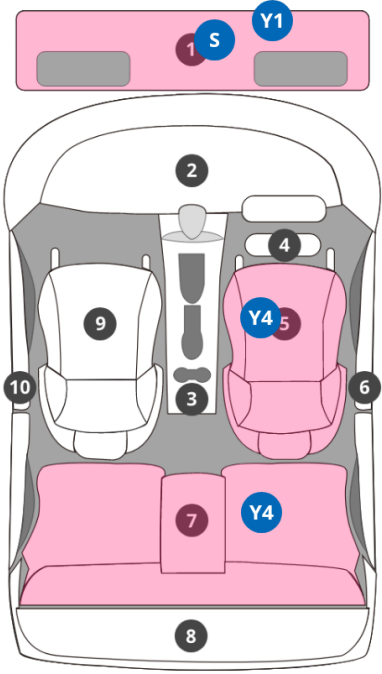
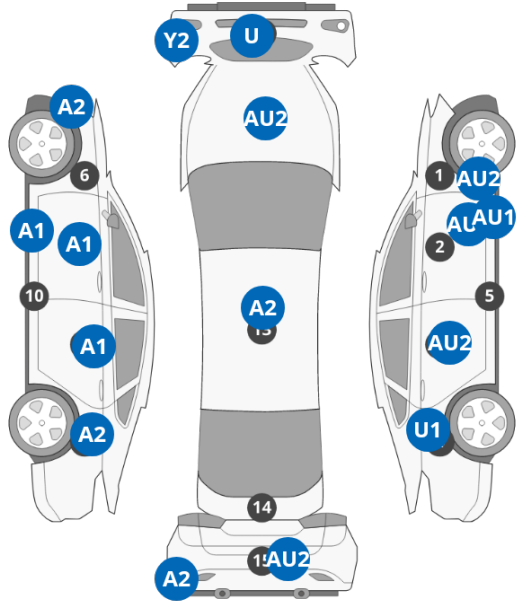
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	112	104	108
2	Boot Lid	103.2	99	99	111
3	Roof	99.3	96	95	88/118
4	Left Front Fender	101.0	97	95	111
5	Left Front Door	135.6	128	130	149
6	Center Panel Left				
7	Left Rear Door	103.6	117	100	94
8	Left Back Panel	107.6	106	108	109
9	Right Front Fender	101.4	102	99	103
10	Right Front Door	107.0	109	106	106
11	Center Panel Right				
12	Right Rear Door	105.3	105	101	110
13	Right Back Panel	109.3	108	106	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Ceiling - Grime - Minimal	Remarks Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and warranty booklet and Sparetire, Jack and Incomplete Tools. scratch headlight and tail light. rear seats some molds.