

General Information

Date & Time: 06, Aug, 2025 12:47

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	53,473
Registration No.	NHR4374	Chassis No.	MHFAA1BY4P0018266
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



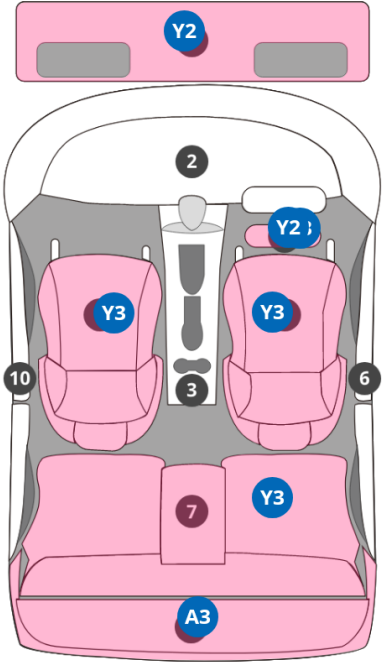
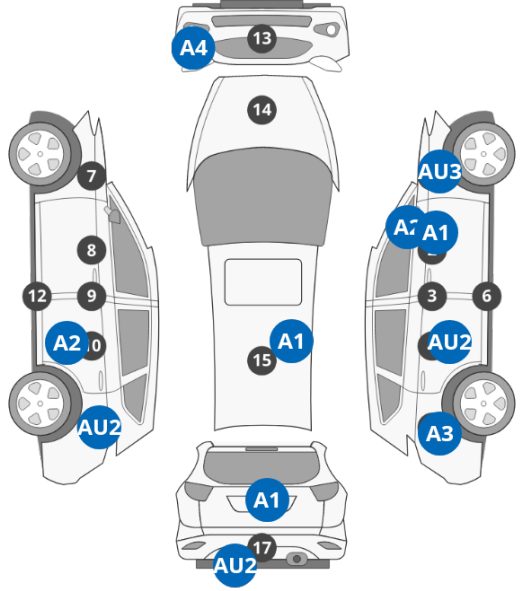
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	115	123	119
2	Boot Lid	107.3	112	115	95
3	Roof	137.5	135	141	157/117
4	Left Front Fender	108.6	108	110	108
5	Left Front Door	122.6	111	123	134
6	Center Panel Left				
7	Left Rear Door	119.0	124	113	120
8	Left Back Panel	110.5	121	113	98
9	Right Front Fender	104.8	118	105	91
10	Right Front Door	123.3	129	125	116
11	Center Panel Right				
12	Right Rear Door	118.6	117	116	123
13	Right Back Panel	111.6	109	104	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small	Remarks (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with LTO plate/with spare tire/ with jack and incomplete tools/with warranty booklet/trunk room dirty/ with reverse camera / with spare key