

General Information

Date & Time: 04, Aug, 2025 13:37

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,194
Registration No.	DBR3756	Chassis No.	PA1B18F36R4274948
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



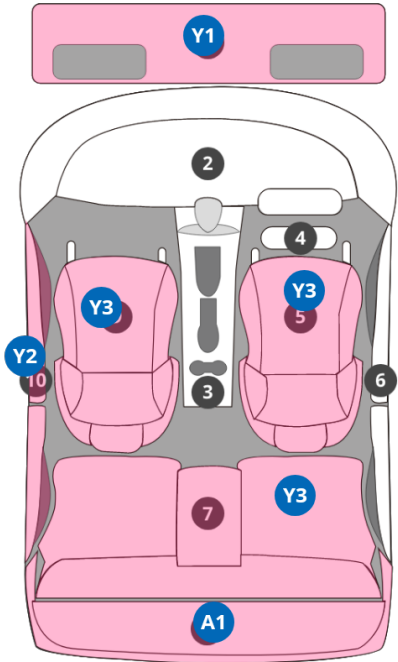
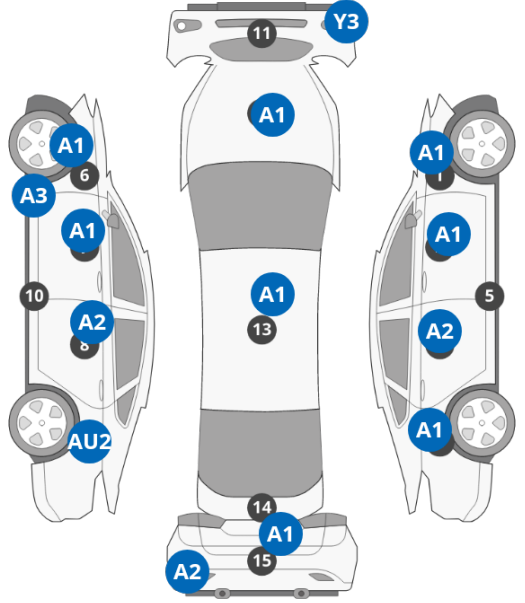
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	134	101	115
2	Boot Lid	119.3	116	118	124
3	Roof	100.1	100	103	96/102
4	Left Front Fender	105.6	103	100	114
5	Left Front Door	109.0	113	106	108
6	Center Panel Left				
7	Left Rear Door	114.6	125	106	113
8	Left Back Panel	113.6	120	113	108
9	Right Front Fender	107.3	114	98	110
10	Right Front Door	110.6	116	101	115
11	Center Panel Right				
12	Right Rear Door	112.0	102	104	130
13	Right Back Panel	114.0	116	108	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, scratches on tail light