

General Information

Date & Time: 06, Aug, 2025 12:52

Make	Toyota	Model	Rush
YOM	2021	Odo Meter Reading	20,824
Registration No.	NDZ5408	Chassis No.	MHKE8FF3PMK033289
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



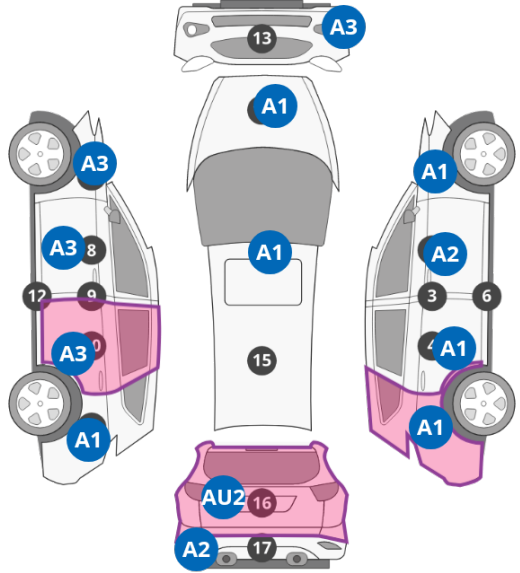
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.3	106	101	100
2	Boot Lid	221.6	169	205	291
3	Roof	104.7	96	90	122/111
4	Left Front Fender	115.6	115	117	115
5	Left Front Door	120.3	123	115	123
6	Center Panel Left				
7	Left Rear Door	158.0	113	118	243
8	Left Back Panel	112.3	113	115	109
9	Right Front Fender	109.3	116	109	103
10	Right Front Door	113.6	110	114	117
11	Center Panel Right				
12	Right Rear Door	118.0	117	123	114
13	Right Back Panel	152.3	105	104	248

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Large / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Overall Interior - Smell - Yes	Remarks (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, no jack and tools, with spare tire, weak battery, traces of adhesive on doors, scratches on headlight and tail light