

General Information

Date & Time: 04, Aug, 2025 15:04

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	7,549
Registration No.	NFR1077	Chassis No.	MHKAA1BC5RJ017078
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



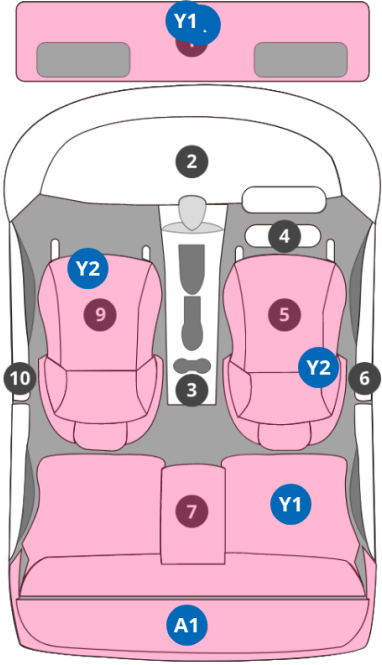
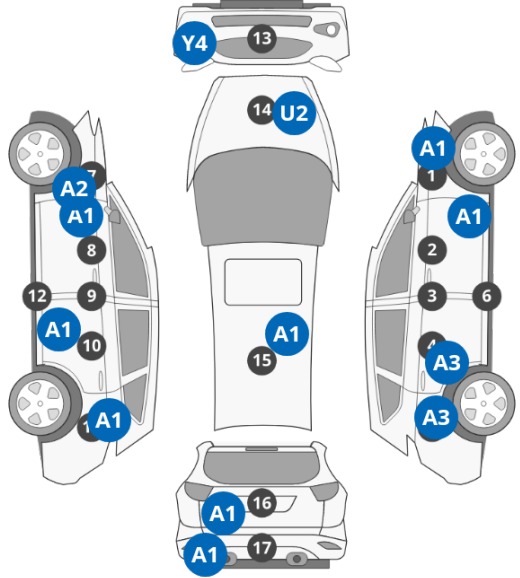
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	111	101	116
2	Boot Lid	90.6	87	93	92
3	Roof	88.1	85	93	83/92
4	Left Front Fender	109.0	100	109	118
5	Left Front Door	123.3	114	121	135
6	Center Panel Left				
7	Left Rear Door	117.6	133	112	108
8	Left Back Panel	98.5	104	98	93
9	Right Front Fender	113.3	112	116	112
10	Right Front Door	127.3	131	131	120
11	Center Panel Right				
12	Right Rear Door	115.3	114	107	125
13	Right Back Panel	103.4	106	97	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Dent - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, scratches on tail light and headlights