

General Information

Date & Time: 01, Aug, 2025 15:43

Make	Nissan	Model	Juke
YOM	2018	Odo Meter Reading	59,148
Registration No.	NBF6379	Chassis No.	JNF1BAF15Z0600734
CC	1.6	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



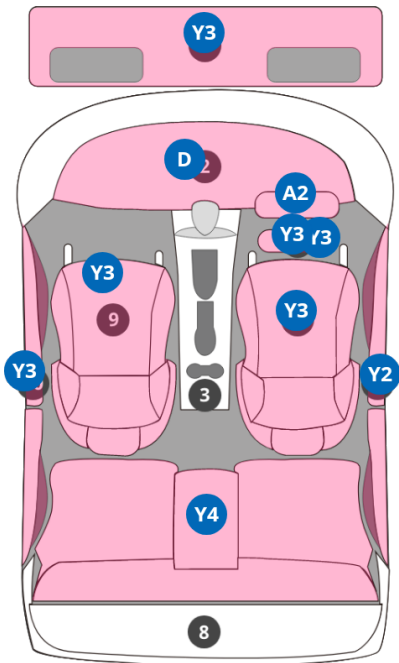
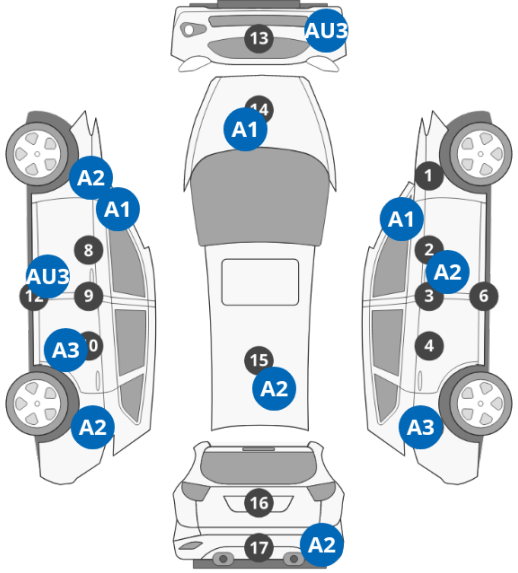
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	158.0	156	173	145
2	Boot Lid	166.3	161	173	165
3	Roof	98.7	104	105	94/92
4	Left Front Fender	102.8	106	108	95
5	Left Front Door	167.6	154	177	172
6	Center Panel Left				
7	Left Rear Door	169.3	177	172	159
8	Left Back Panel	103.5	104	99	108
9	Right Front Fender	175.6	145	176	206
10	Right Front Door	167.0	167	164	170
11	Center Panel Right				
12	Right Rear Door	169.0	150	152	205
13	Right Back Panel	101.6	102	100	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak</p>

<p>Inspector Notes</p>
<p>Driver side power window issue. Left aircon issue. With warranty booklet, spare tire and jack. Without tools. 2 keys. With LTO plate.</p>