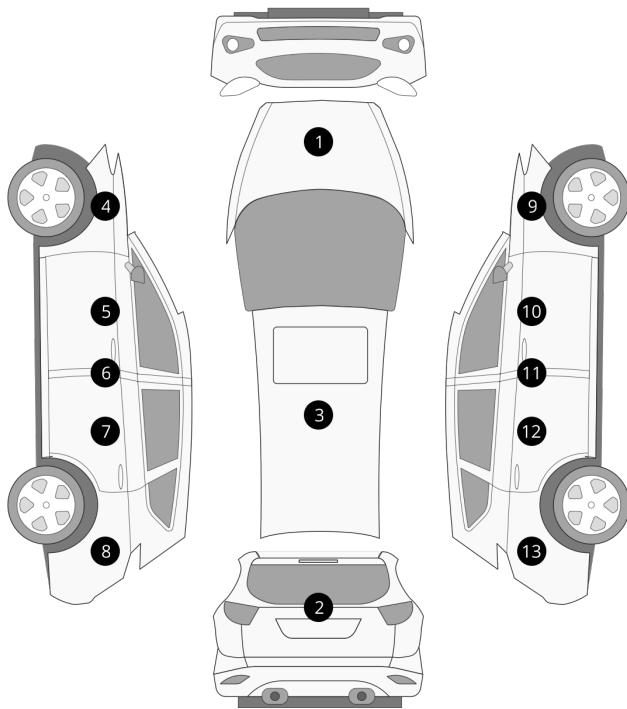


General Information

Date & Time: 04, Aug, 2025 11:01

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	18,013
Registration No.	NKL4658	Chassis No.	PA1B18F35R4279350
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



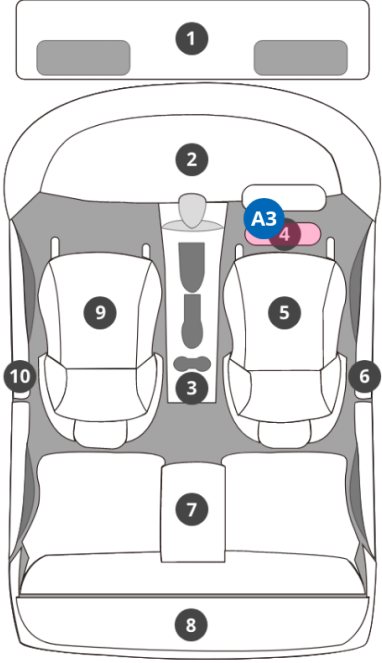
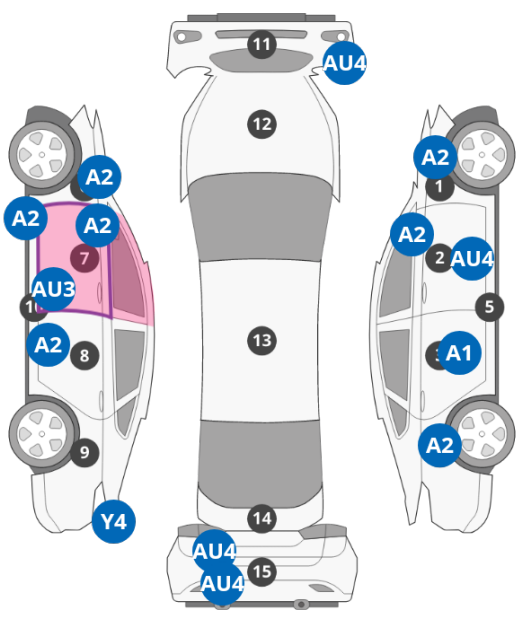
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.5	103	100	111
2	Boot Lid	106.0	101	107	110
3	Roof	105.0	115	98	101/106
4	Left Front Fender	98.7	106	94	96
5	Left Front Door	110.3	102	110	119
6	Center Panel Left				
7	Left Rear Door	97.7	100	99	94
8	Left Back Panel	111.0	120	114	99
9	Right Front Fender	97.8	100	94	100
10	Right Front Door	99.2	100	96	102
11	Center Panel Right				
12	Right Rear Door	99.5	98	100	101
13	Right Back Panel	103.1	93	98	118

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Medium	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Front Door, Molding - Repair mark - Difference in Color / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Crack, Gap - Large
Frame Evaluation : D	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/ no tools/ no warranty booklet/ no jack/ trunk closing issue/ vehicle not starting/ possible flooding/non moving vehicle/