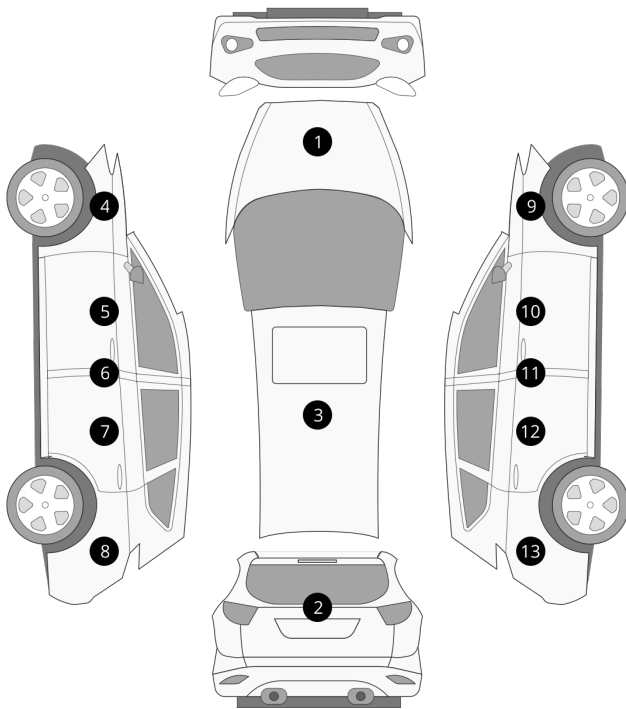


## General Information

Date & Time: 04, Aug, 2025 14:32

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2024    | Odo Meter Reading | 36,834            |
| Registration No. | CCA9096 | Chassis No.       | PA1B18F32R4260481 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Blue    |                   |                   |

## Body / Panel Condition



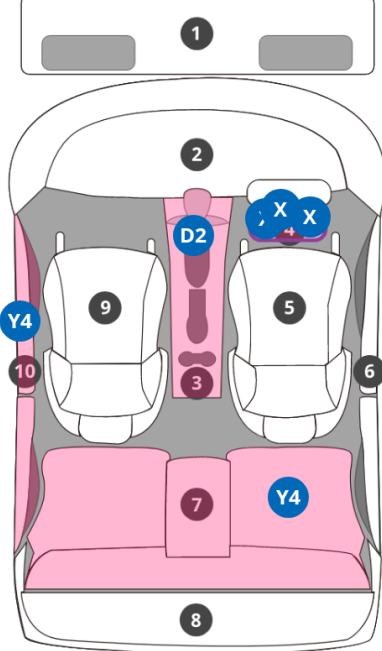
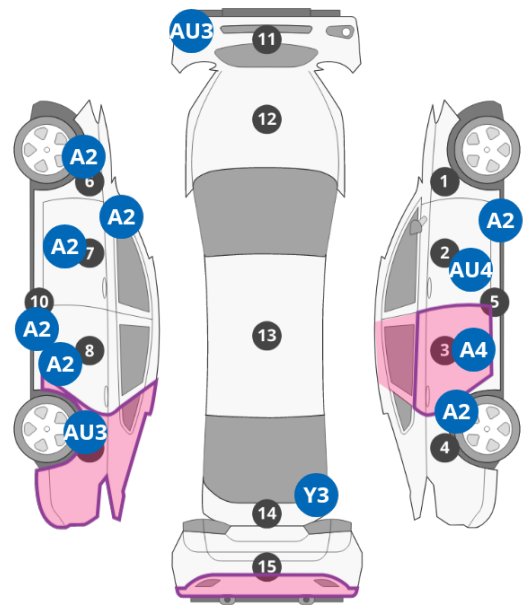
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 97.8          | 100    | 94     | 99       |
| 2  | Boot Lid           | 107.3         | 121    | 101    | 100      |
| 3  | Roof               | 96.8          | 99     | 96     | 93/99    |
| 4  | Left Front Fender  | 94.4          | 95     | 92     | 97       |
| 5  | Left Front Door    | 93.8          | 100    | 89     | 93       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 96.5          | 102    | 100    | 88       |
| 8  | Left Back Panel    | 347.6         | 171    | 708    | 164      |
| 9  | Right Front Fender | 90.4          | 87     | 92     | 92       |
| 10 | Right Front Door   | 93.0          | 98     | 89     | 92       |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 146.6         | 136    | 152    | 152      |
| 13 | Right Back Panel   | 94.9          | 91     | 90     | 104      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>C</b>                                                                                                                                                                                                                     | Exterior Evaluation : <b>E</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <p><b>Remarks</b><br/>Console, Switches, Vents - Loose, Deformed - Small / Rear Seat - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes</p>  | <p><b>Remarks</b><br/>(L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Crack, Gap - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small</p> |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                        | Functional Evaluation : <b>B</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <p><b>Remarks</b><br/>Defects not found</p>                                                                                                                                                                                                        | <p><b>Remarks</b><br/>Battery - Weak - Yes / Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |

| Inspector Notes                                                                         |
|-----------------------------------------------------------------------------------------|
| no warranty booklet/no spare tire/ no tools/ no jack/ loose shift knob/ with LTO plate/ |