

General Information

Date & Time: 16, Nov, 2024 12:46

Make	Toyota	Model	Vios
YOM	2024	Mileage	3,463
Registration No.	NFS3046	Chassis No.	PA1B18F3R4242445
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



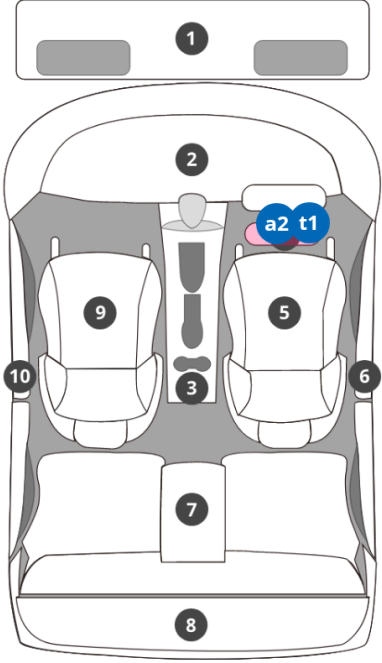
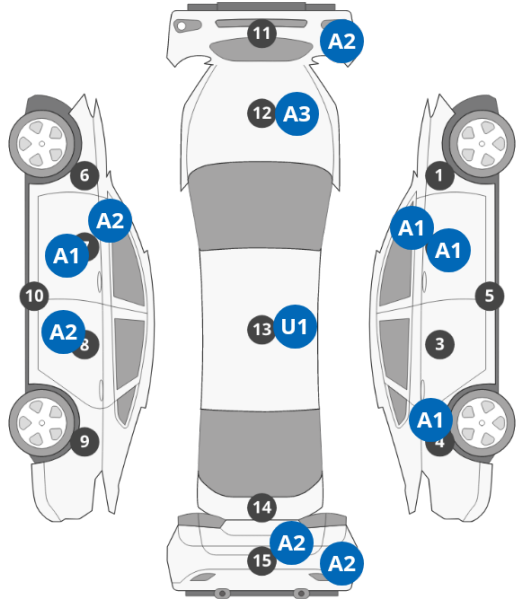
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	110	103	107
2	Boot Lid	104.3	106	103	104
3	Roof	109.5	119	107	104/108
4	Left Front Fender	103.1	105	106	98
5	Left Front Door	100.3	101	100	100
6	Center Panel Left				
7	Left Rear Door	96.5	102	96	91
8	Left Back Panel	113.6	117	116	108
9	Right Front Fender	102.0	101	102	103
10	Right Front Door	102.2	103	99	105
11	Center Panel Right				
12	Right Rear Door	97.3	91	96	105
13	Right Back Panel	104.9	93	106	116

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / (R) Front Floor Mat - Cigarette Burns - Burnt Minimal	Remarks Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
swirlmarks and hairline scratches around the exterior. no tools. with user manual and without warranty booklet.