

General Information

Date & Time: 04, Aug, 2025 10:02

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	51,398
Registration No.	BAE9636	Chassis No.	PA1B18F39M4148298
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



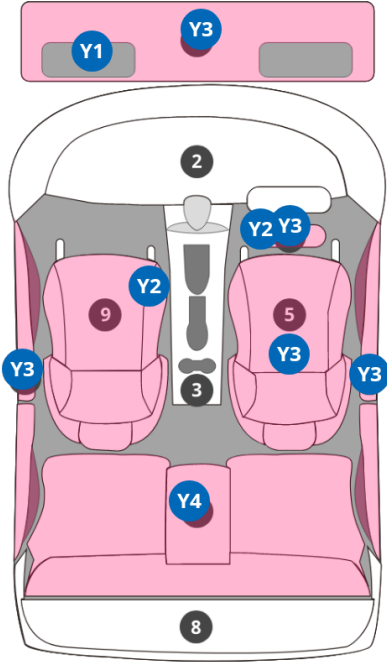
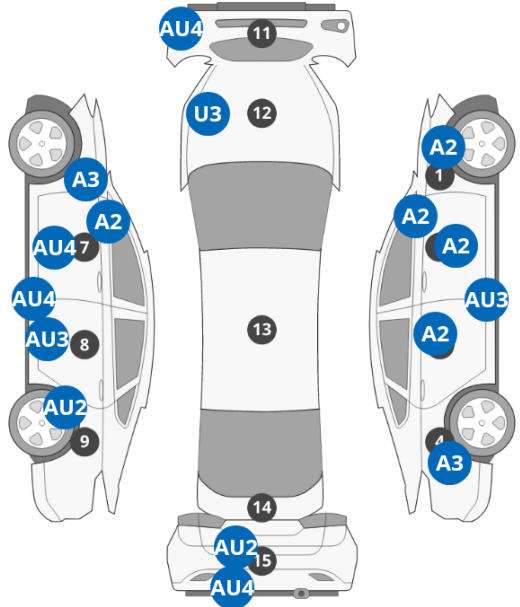
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	101	105	108
2	Boot Lid	99.8	104	95	101
3	Roof	96.7	107	88	96/96
4	Left Front Fender	93.7	102	91	88
5	Left Front Door	98.7	99	102	96
6	Center Panel Left				
7	Left Rear Door	103.3	101	102	107
8	Left Back Panel	110.0	113	106	111
9	Right Front Fender	98.0	99	94	101
10	Right Front Door	102.7	99	105	104
11	Center Panel Right				
12	Right Rear Door	112.3	114	111	112
13	Right Back Panel	107.3	102	105	115

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. Rusted bolts at seat railings. Trunk floor partially missing. Without warranty booklet, tools and seat cover. With spare tire and jack. 1 key. With LTO plate.