

General Information

Date & Time: 04, Aug, 2025 10:30

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	99,999
Registration No.	NHD2580	Chassis No.	PA1B18F32N4198915
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



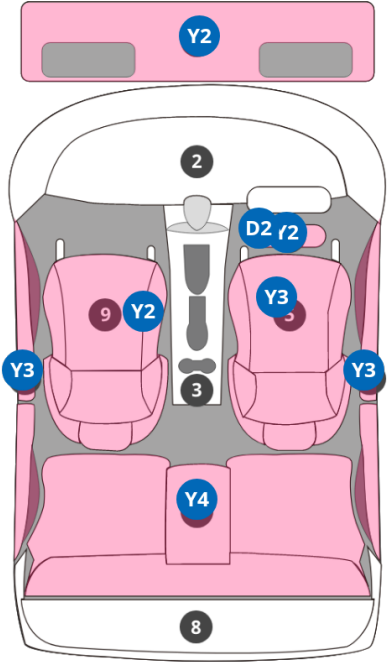
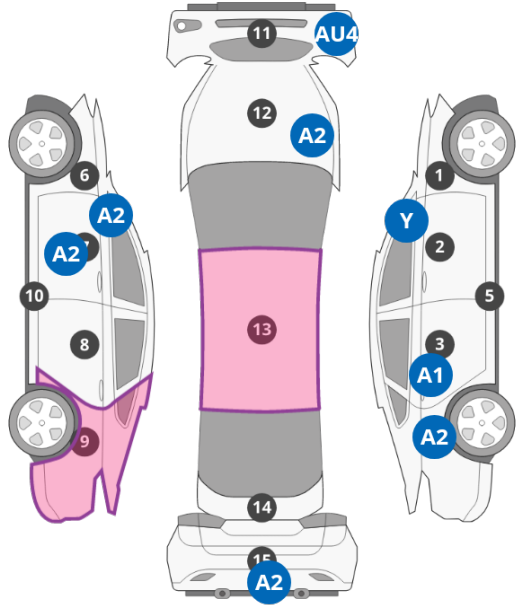
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	103	106	110
2	Boot Lid	127.6	127	134	122
3	Roof	213.7	212	211	210/222
4	Left Front Fender	96.0	101	94	93
5	Left Front Door	100.9	107	99	97
6	Center Panel Left				
7	Left Rear Door	99.2	99	95	103
8	Left Back Panel	275.0	226	342	257
9	Right Front Fender	103.6	102	105	104
10	Right Front Door	105.6	104	109	104
11	Center Panel Right				
12	Right Rear Door	106.7	99	107	114
13	Right Back Panel	109.3	111	102	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Repair mark - Difference in Color / (L) Rear Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Roof and side mirrors wrapped in black. Right side mirror issue. Aftermarket rear view mirror loose. Without warranty booklet, tools and seat cover. with spare tire and jack. 1 key. With LTO plate.