

General Information

Date & Time: 04, Aug, 2025 15:00

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	19,462
Registration No.	CCC3417	Chassis No.	PA1B18F35P4231019
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



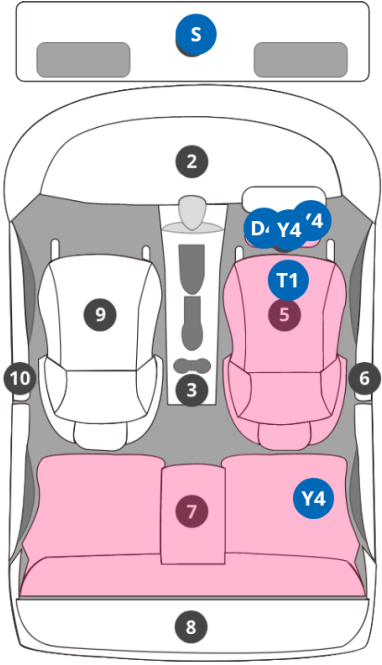
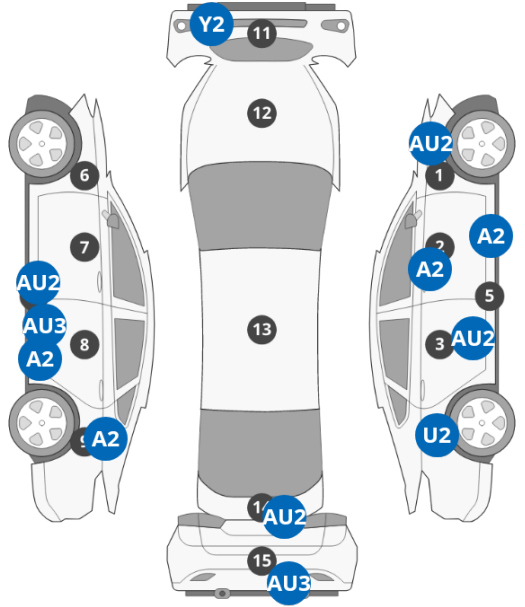
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.5	99	98	95
2	Boot Lid	104.6	103	106	105
3	Roof	98.9	108	99	93/96
4	Left Front Fender	97.2	97	95	100
5	Left Front Door	101.9	102	100	104
6	Center Panel Left				
7	Left Rear Door	99.2	110	97	91
8	Left Back Panel	101.7	104	99	102
9	Right Front Fender	94.4	97	96	91
10	Right Front Door	100.1	102	97	101
11	Center Panel Right				
12	Right Rear Door	108.0	106	103	115
13	Right Back Panel	98.1	91	95	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Large / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Floor Mat - Grime - Large / Overall Interior - Smell - Yes / (R) Front Seat - Cigarette Burns - Burnt Minimal	Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools/ with jack and spare tire/ with LTO plate/ plate light issue/