

General Information

Date & Time: 04, Aug, 2025 13:00

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	33,571
Registration No.	CCF6305	Chassis No.	PA1B18F38R4266821
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



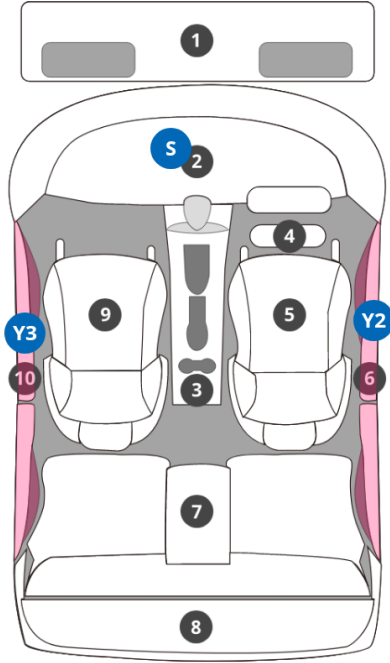
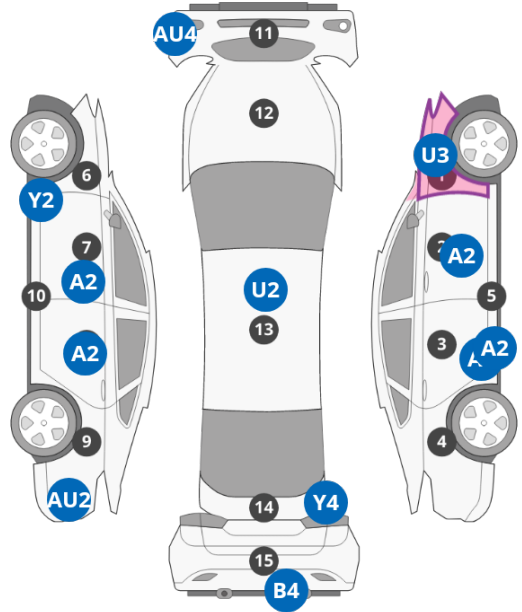
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.9	98	94	102
2	Boot Lid	171.3	165	169	180
3	Roof	108.5	106	115	103/110
4	Left Front Fender	100.3	100	101	100
5	Left Front Door	101.8	105	99	102
6	Center Panel Left				
7	Left Rear Door	107.3	109	110	103
8	Left Back Panel	112.6	117	110	111
9	Right Front Fender	222.3	203	309	155
10	Right Front Door	105.0	103	110	102
11	Center Panel Right				
12	Right Rear Door	101.7	92	97	117
13	Right Back Panel	139.6	146	139	134

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Modified - Large / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Dent - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no tools/ possible flooding/with spare tire and jack/