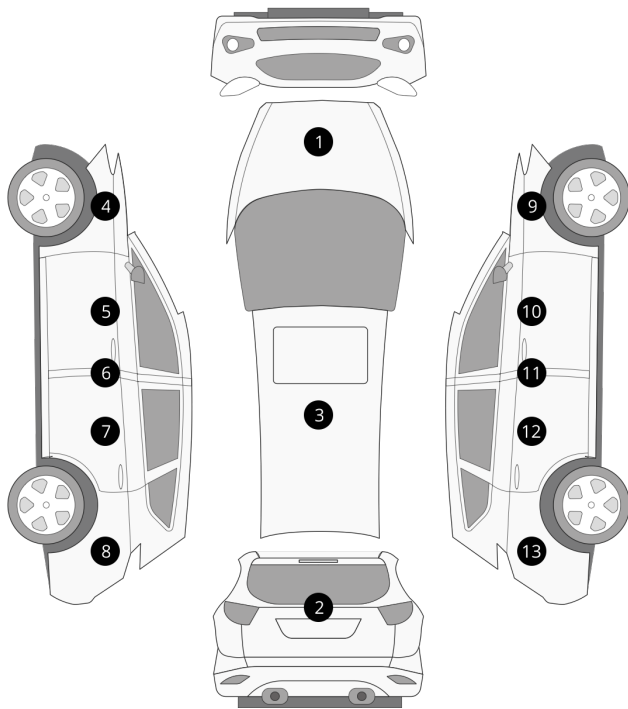


General Information

Date & Time: 16, Nov, 2024 15:41

Make	Toyota	Model	Vios
YOM	2024	Mileage	12,102
Registration No.	EAG6754	Chassis No.	PA1B18F37P4232902
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



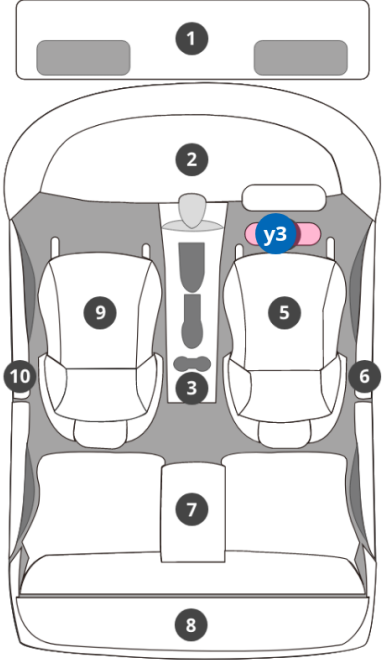
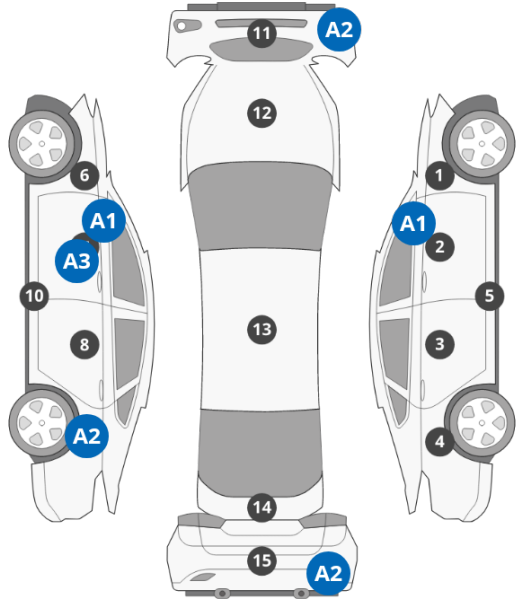
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	122	114	118
2	Boot Lid	105.0	100	107	108
3	Roof	112.0	118	111	110/109
4	Left Front Fender	105.3	107	106	103
5	Left Front Door	198.0	131	139	324
6	Center Panel Left				
7	Left Rear Door	158.3	192	156	127
8	Left Back Panel	127.3	135	132	115
9	Right Front Fender	117.0	114	118	119
10	Right Front Door	114.6	116	116	112
11	Center Panel Right				
12	Right Rear Door	109.6	105	108	116
13	Right Back Panel	121.6	116	127	122

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium	Remarks (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

swirlmarks and hairline scratches around the exterior. without user manual. with warranty booklet.