

General Information

Date & Time: 04, Aug, 2025 17:54

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	22,878
Registration No.	CCE8120	Chassis No.	PA1B18F3XR465203
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



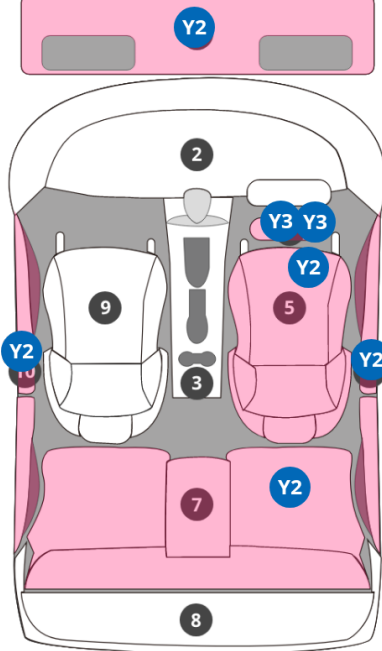
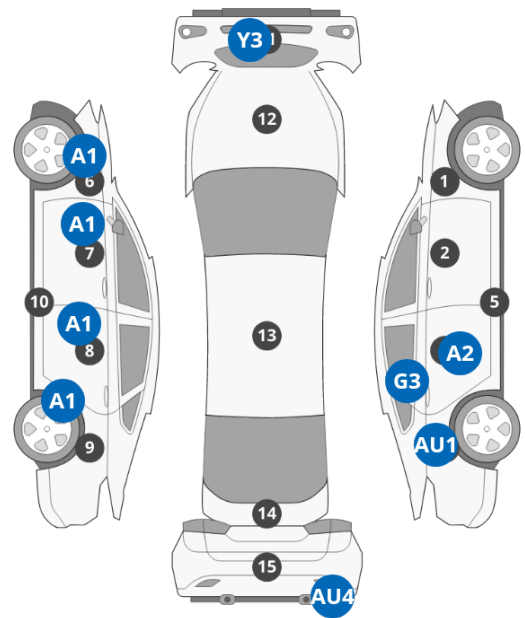
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	126	105	128
2	Boot Lid	110.3	102	109	120
3	Roof	106.4	100	108	120/98
4	Left Front Fender	94.2	100	92	91
5	Left Front Door	105.0	103	101	111
6	Center Panel Left				
7	Left Rear Door	120.6	103	127	132
8	Left Back Panel	104.4	114	99	100
9	Right Front Fender	122.3	101	168	98
10	Right Front Door	99.5	101	98	100
11	Center Panel Right				
12	Right Rear Door	99.8	93	100	107
13	Right Back Panel	108.9	105	100	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Small / Mat Other - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Side Window - Scratch, Stone chip - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Damaged grille. Toe hook cover missing. With warranty booklet and spare tire. Without jack, tools and seat cover. 1 key. With LTO plate.