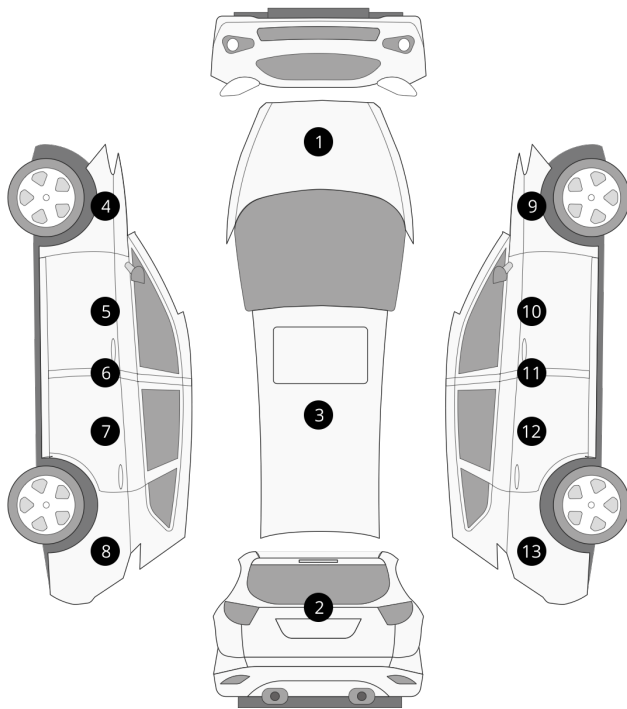


General Information

Date & Time: 04, Aug, 2025 15:31

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	12,974
Registration No.	CCF2184	Chassis No.	PA1B18F30R4260091
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



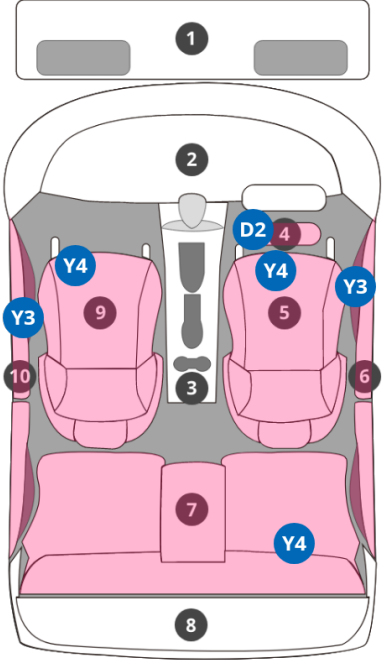
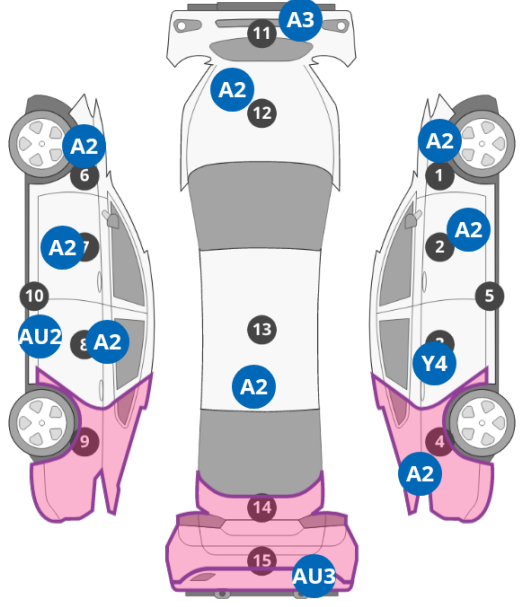
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	101	111	121
2	Boot Lid	105.2	118	97	101
3	Roof	104.2	108	101	101/107
4	Left Front Fender	92.3	92	87	99
5	Left Front Door	98.0	97	98	99
6	Center Panel Left				
7	Left Rear Door	171.3	177	162	175
8	Left Back Panel	97.2	91	100	101
9	Right Front Fender	100.8	98	100	105
10	Right Front Door	102.3	98	111	99
11	Center Panel Right				
12	Right Rear Door	105.0	106	106	103
13	Right Back Panel	161.3	160	175	149

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with sparetire and jack/ no tools/ with LTO plate