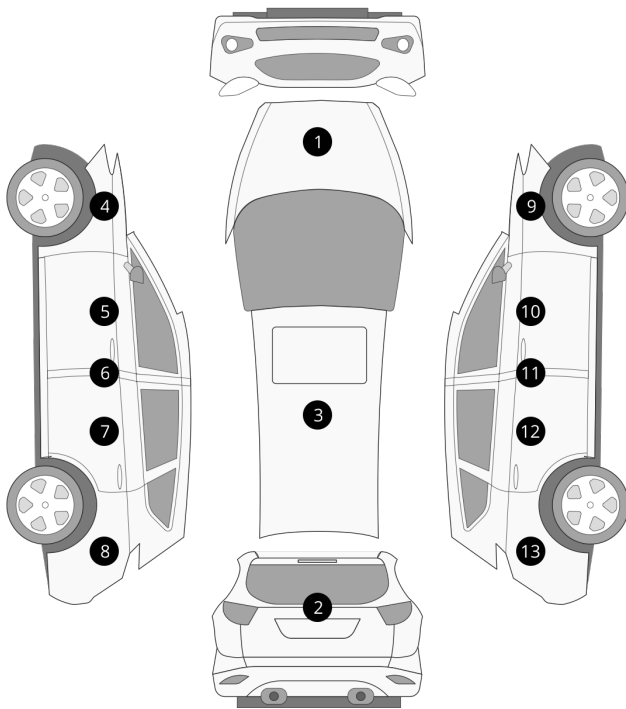


General Information

Date & Time: 04, Aug, 2025 16:42

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	18,204
Registration No.	CCA6079	Chassis No.	PA1B18F36R46857
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



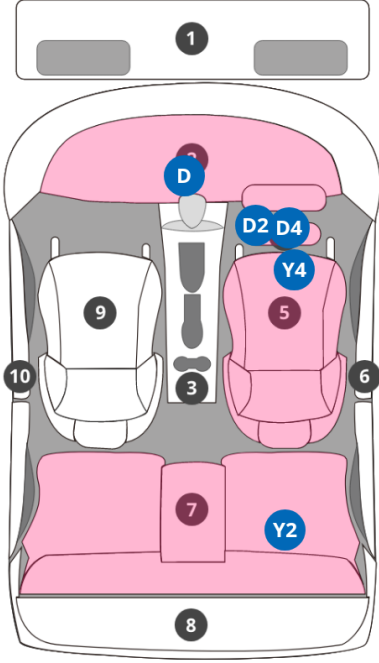
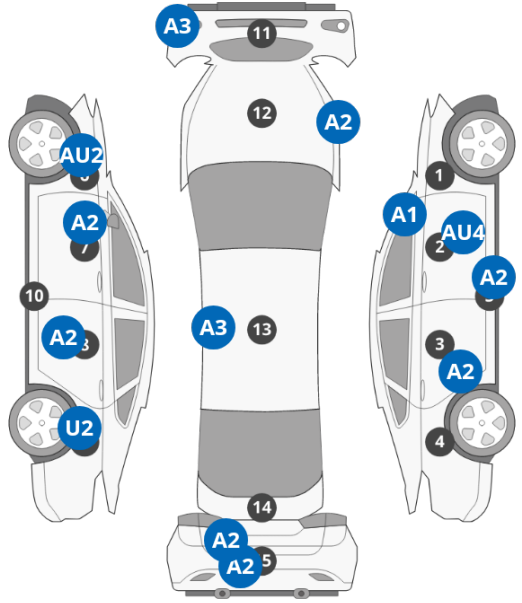
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	157.0	160	150	161
2	Boot Lid	95.6	97	91	100
3	Roof	94.0	95	90	92/99
4	Left Front Fender	89.8	95	85	89
5	Left Front Door	90.4	89	88	95
6	Center Panel Left				
7	Left Rear Door	183.6	176	173	202
8	Left Back Panel	296.3	542	212	135
9	Right Front Fender	92.7	92	93	93
10	Right Front Door	96.3	96	99	94
11	Center Panel Right				
12	Right Rear Door	98.8	95	95	107
13	Right Back Panel	102.5	97	97	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Large	Remarks Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet/with LTO plate/with spare tire and jack/ with tools rear sensor not working/